Cl **00**   *SC*   *P* **3**   *L* **4**   # 1
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
    MediumDependent Interface

SuggestedRemedy
    Medium Dependent Interface

Response   *Response Status* **C**
    ACCEPT. Replace "MediumDependent" with Medium Dependent"

Cl **00**   *SC*   *P* **3**   *L* **5**   # 2
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
    physical layer (in Keywords section most of the words start with a capital letter, should be uniform)

SuggestedRemedy
    Physical Layer

Response   *Response Status* **C**
    ACCEPT. Replace "physical layer" with "Physical Layer" as per the IEEE 802.3 Working Group editorial guidelines.

Cl **01**   *SC* **1.5**   *P* **24**   *L* **32**   # 3
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
    PLCS

SuggestedRemedy
    PLCA

Response   *Response Status* **C**
    ACCEPT. Replace "PLCS" on line 32 with "PLCA" (Same resolution proposed for comments #139, #3, and #188)

Cl **45**   *SC* **45.2.1.174c**   *P* **36**   *L* **13**   # 4
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *EZ*
    0 1 1 = Reserved (in 146.5.2 a third test mode for the PSD mask test has been added, which is sending Idles in Master mode, therefore it makes sense to be able to enable this also through the test mode register)

SuggestedRemedy
    0 1 1 = Test mode 3

Response   *Response Status* **C**
    ACCEPT. Replace "0 1 1 = Reserved" with "0 1 1 = Test mode 3"

Cl **104**   *SC* **104.9.4.3**   *P* **76**   *L* **44**   # 5
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
    With transfer function H2(f) specified in Equation (104-3) where f2=0.1 MHz ±1%

SuggestedRemedy
    Change in H2(f) the 2 in subscript. Change f2=0.1 MHz ±1% to f2 = 0.1 MHz ± 1 % (with the 2 in f2 in subscript).

Response   *Response Status* **C**
    ACCEPT. Change the 2 in "H2f" to subscript, change the 2 in "f2" to subscript, and insert non-breaking space after "±".

Cl **104**   *SC* **104.9.4.4**   *P* **77**   *L* **11**   # 6
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
    146.8.xxx (reference needs to be specified)

SuggestedRemedy
    146.8.4

Response   *Response Status* **C**
    ACCEPT. Replace "146.8.xxx" with "146.8.4".

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **6**   Page 1 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:48 PM
SORT ORDER: Comment ID

Cl **146**　　　*SC* **146.1**　　　　　　*P* **79**　　　*L* **19**　　　　# 7
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　10BASE-T1LPHY (add space before PHY)

SuggestedRemedy
　10BASE-T1L PHY

Response　　　　　　*Response Status* **C**
　ACCEPT.

Cl **146**　　　*SC* **146.1.2**　　　　　*P* **81**　　　*L* **3**　　　　# 8
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　. link utilization.. (remove second dot)

SuggestedRemedy
　. link utilization.

Response　　　　　　*Response Status* **C**
　ACCEPT.

Cl **146**　　　*SC* **146.1.2**　　　　　*P* **81**　　　*L* **11**　　　　# 9
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　The MDI is specified in 146.8.. (remove second dot)

SuggestedRemedy
　The MDI is specified in 146.8.

Response　　　　　　*Response Status* **C**
　ACCEPT.

Cl **146**　　　*SC* **146.1.2**　　　　　*P* **81**　　　*L* **17**　　　　# 10
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　. in the Task Force review process.. (remove second dot)

SuggestedRemedy
　. in the Task Force review process.

Response　　　　　　*Response Status* **C**
　ACCEPT.

Cl **146**　　　*SC* **146.1.2**　　　　　*P* **81**　　　*L* **22**　　　　# 11
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　There is a wrong paragrah separation between line 22 and line 24.

SuggestedRemedy
　Remove the "new paragraph" formatting between line 22 and line 24.

Response　　　　　　*Response Status* **C**
　ACCEPT.

Cl **146**　　　*SC* **146.2**　　　　　　*P* **82**　　　*L* **20**　　　　# 12
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **R**　　　　　　　　　　*Editorial*
　Technology Dependent Interface

SuggestedRemedy
　Remove the Technology Dependent Interface and associated primitives.

Response　　　　　　*Response Status* **C**
　REJECT.
　Technology dependent interface is used to communicate between the PHY and the Auto-
　Negotiation Function (Clause 98). See 98.4

Cl **146**　　　*SC* **146.2**　　　　　　*P* **82**　　　*L* **26**　　　　# 13
Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **T**　　　*Comment Status* **A**　　　　　　　　　　*EZ*
　The TX_CLK arrow has the wrong direction (signal direction should go from PCS to MII)

SuggestedRemedy
　Change arrow direction for TX_CLK signal.

Response　　　　　　*Response Status* **C**
　ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general　　　　*Comment ID* **13**　　Page 2 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn　　　　　　3/6/2018 4:20:48 PM
SORT ORDER: Comment ID

Cl **146**   *SC* **146.2**   *P* **82**   *L* **27**   # 14
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *EZ*
TXD<7:0> (MII is only 4 bits wide)

SuggestedRemedy
TXD<3:0>

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.2**   *P* **82**   *L* **36**   # 15
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
MDI+, MDI- signals are named BI_DA+ and BI_DA- in the rest of the document

SuggestedRemedy
Change MDI+, MDI- to BI_DA+, BI_DA-

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.2**   *P* **82**   *L* **37**   # 16
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *EZ*
RXD<7:0> (MII is only 4 bits wide)

SuggestedRemedy
RXD<3:0>

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.2.1**   *P* **83**   *L* **17**   # 17
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
Chapter headlines 146.2.1 to 146.2.2.3

SuggestedRemedy
Please remove these chapter headlines.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.3.4.1**   *P* **95**   *L* **3**   # 18
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **D**   *State Diagram*
(pcs_reset = ON) + (receiving = FALSE) * [(loc_rcvr_status = NOT_OK) + (link_status = FAIL) + (rcv_jab_detected = TRUE)]

SuggestedRemedy
Change to (pcs_reset = ON) + [(receiving = FALSE) * [(loc_rcvr_status = NOT_OK) + (link_status = FAIL) + (rcv_jab_detected = TRUE)]]

Proposed Response   *Response Status* **Z**
REJECT.

This comment was WITHDRAWN by the commenter.

The * operator takes precedence and adding extra levels of parentheses does not improve clarity, consistent with resolution of comment 190 on draft 1.0

Cl **146**   *SC* **146.3.4.1**   *P* **95**   *L* **3**   # 19
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *State Diagram*
An additional state ("WAIT SCRAMBLER") for descrambler synchronization is required for the state machine to wait until the descrambler is in sync before going into "IDLE" state. Otherwise in case the descrambler is not synchronized, it is possible that the state machine hangs in "BAD DELIMITER" state until jabber is detected and the state machine is resetted. Then the state machine is in "IDLE" state again, but not receiving valid idle data as the descrambler is not synchronized. In this case the state machine jumps from the "IDLE" state into "BAD DELIMITER" state again without syncing the descrambler, thus ending up in an endless loop.

SuggestedRemedy
Add additional state "WAIT SCRAMBLER" as described in presentation "PCS Receive State Diagram" to the PSC receive state diagram.

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Add additional state as shown on slide 2 of Graber_3cg_01_0318.pdf, aligning input conditions editorially with draft and the resolution of comment 18.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **19**   Page 3 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:48 PM
SORT ORDER: Comment ID

Cl **146**   *SC* **146.3.4.1**   *P* **95**   *L* **28**   # 20
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
RSTCD * (valid_dispreset =FALSE) (add space before FALSE)

SuggestedRemedy
RSTCD * (valid_dispreset = FALSE)

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.3.4.1**   *P* **96**   *L* **36**   # 21
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
RSTCD *(Rxn = ESD_ERR4) (missing space before opening bracket)

SuggestedRemedy
RSTCD * (Rxn = ESD_ERR4)

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.4.4.1**   *P* **104**   *L* **16**   # 22
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
Misalignment of 'detected.'

SuggestedRemedy
Please align the word 'detected.' below 'Reliable operation .'.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.4.4.2**   *P* **104**   *L* **40**   # 23
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
Missing new line before 'maxwait_timer'

SuggestedRemedy
Add new line before 'maxwait_timer' to have the same style as for other sections.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.4.4.2**   *P* **104**   *L* **43**   # 24
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
Missing new line before 'minwait_timer'

SuggestedRemedy
Add new line before 'minwait_timer' to have the same style as for other sections.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.4.4.3**   *P* **105**   *L* **1**   # 25
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
State diagram. (remove dot)

SuggestedRemedy
State diagram

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.1**   *P* **106**   *L* **46**   # 26
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
EMC tests. (remove dot)

SuggestedRemedy
EMC tests

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.1**   *P* **108**   *L* **35**   # 27
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   EZ
. peak-to-peak in using normal driving levels . (remove 'in')

SuggestedRemedy
. peak-to-peak using normal driving levels .

Response   *Response Status* **C**
ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **27**

Page 4 of 37
3/6/2018 4:20:48 PM

Cl **146**   *SC* **146.5.4.1**   *P* **108**   *L* **42**   # 28
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
Default setting is to use Auto-Negotiation (missing dot at the end of the sentence)

SuggestedRemedy
Default setting is to use Auto-Negotiation.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.2**   *P* **108**   *L* **48**   # 29
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *Editorial*
See also 146.5.5 for normalized test pattern. (there are no more normalized test patterns as they have been replaced by a PSD mask definition).

SuggestedRemedy
Please remove sentence.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **7**   # 30
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *PMA*
(normal operation) add 'in Idle mode' to be consistent with the description of the test mode on page 107, line 30.

SuggestedRemedy
(normal operation in Idle mode)

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
While test mode 3 is supposed to be in idle mode, the specification is meant to reflect normal operation, not just idle mode.

Change "(normal operation)" to "(reflecting normal operation)"

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **8**   # 31
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *PMA*
. for the 2.4 Vpp operating mode . (it seems to make sense to add also a reference to the mode using normal driving levels, as this is described in other parts of the standard).

SuggestedRemedy
. for the 2.4 Vpp operating mode using normal driving levels .

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
See comment 33:
The additional text is unnecessary and can lead to the conclusion that there is the 1Vpp operating mode, as well as an additional mode using the 1Vpp + some unspecified reduced driving levels.

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **8**   # 32
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
. operating mode and and 1.2 ± 1.0 dBm . (remove second 'and')

SuggestedRemedy
. operating mode and 1.2 ± 1.0 dBm ...

Response   *Response Status* **C**
ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID   *Comment ID* **32**   Page 5 of 37
3/6/2018 4:20:48 PM

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **8**   # 33
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *PMA*
. for the 1.0 Vpp operating mode. (it seems to make sense to add also a reference to the mode using reduced driving levels, as this is described in other parts of the standard).

SuggestedRemedy
. for the 1.0 Vpp operating mode using reduced driving levels.

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
The additional text is unnecessary and can lead to the conclusion that there is the 1Vpp operating mode, as well as an additional mode using the 1Vpp + some unspecified reduced driving levels.

Editorial license to change all occurances of "normal/reduced driving levels" to 2.4Vpp/1.0Vpp operating modes.

Change 146.5.6 (P111 L47) from: "2.76 Vpp for the normal driving levels and 1.15 Vpp for the reduced driving levels" to "2.76 Vpp for the 2.4 Vpp operating mode and 1.15 Vpp for the 1.0 Vpp operating mode"

Change 146.5.4.1 (P108 L35) from: "The transmitter output voltage shall be 2.4 V ± 5 % peak-to-peak in using normal driving
levels and 1.0 V ± 5 % peak-to-peak using reduced driving levels." to:
"The transmitter output voltage have two modes - one with a 2.4 V ± 5 % peak-to-peak (the 2.4 Vpp operating mode) and one with 1.0 V ± 5 % peak-to-peak (the 1.0 Vpp operating mode)."

Change 146.5.6 (P111 L47) from: "2.76 Vpp for the normal driving levels and 1.15 Vpp for the reduced driving levels" to "2.76 Vpp for the 2.4 Vpp operating mode and 1.15 Vpp for the 1.0 Vpp operating mode"

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **9**   # 34
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *EZ*
. using the test fixture 2 shown in Figure 146-18 . (it seems to make sense to remove the '2' as the text fixture is already described by the reference to Figure 146-18 or alternatively also name the Figure 146-18 accordingly)

SuggestedRemedy
. using the test fixture shown in Figure 146-18 .

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **13**   # 35
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *EZ*
. are considered in PSD measurement. (add 'the' before 'PSD measurement')

SuggestedRemedy
. are considered in the PSD measurement.

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **40**   # 36
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *EZ*
square brackets in Equation (146-7)

SuggestedRemedy
Please remove the square brackets in Equation (146-7)

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.4**   *P* **109**   *L* **51**   # 37
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *EZ*
square brackets in Equation (146-9)

SuggestedRemedy
Please remove the square brackets in Equation (146-9)

Response   *Response Status* **C**
ACCEPT.

Cl **146**   *SC* **146.5.4.4**   *P* **110**   *L* **1**   # 38
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type   **E**   *Comment Status* **A**   *EZ*
. is the frequency in MHz (add dot at the end of the sentence)

SuggestedRemedy
. is the frequency in MHz.

Response   *Response Status* **C**
ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **38**

Page 6 of 37
3/6/2018 4:20:48 PM

Cl **146**   *SC* **146.5.4.4**   *P* **110**   *L* **11**   # 39

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *EZ*

Lower PSD mask for 2.4 Vpp and 1.0 Vpp shows a wrong corner frequency of 4 MHz instead of 2.5 MHz (therefore also the PSD values at 5 MHz are too high)

SuggestedRemedy

Please change drawing to fit Equations (146-7) and (146-9).

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.5.5.3**   *P* **111**   *L* **33**   # 40

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*

. within the PHY into account.. (remove second dot)

SuggestedRemedy

. within the PHY into account.

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.5.6**   *P* **111**   *L* **46**   # 41

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*

When measured with 100 O ± 0.1 % termination, transmit differential signal at MDI shall be . (add 'the' before 'transmit' and 'the' before 'MDI')

SuggestedRemedy

When measured with 100 O ± 0.1 % termination, the transmit differential signal at the MDI shall be .

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.6.2**   *P* **113**   *L* **9**   # 42

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*

. can be selected by setting bits 1.2100.14 (BASE-T1L PMA/PMD Control Register) . (change 'bits' to 'bit' and BASE-T1L to BASE-T1, as this is the universal register for the BASE-T1 PHYs)

SuggestedRemedy

. can be selected by setting bit 1.2100.14 (BASE-T1 PMA/PMD Control Register) .

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.6.3**   *P* **113**   *L* **22**   # 43

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **T**   *Comment Status* **A**   *Management*

Only a few of the relevant registers are given in Table 146-4, other registers are missing.

SuggestedRemedy

Change Table 146-4 according to presentation "MDIO Register Mapping"

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
See presentation Graber_3cg_02_0318.pdf, slide 2.
Change "Reduced transmit level" to "Transmit voltage amplitude control" both in the table and in the corresponding entry in Clause 45.
Do not add "10BASE-T1L test mode control register" row
Do not add rows for Transmit fault bit or Receive fault bit status.

Cl **146**   *SC* **146.7.1.3**   *P* **115**   *L* **37**   # 44

Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *Link Segment*

Maximum link delay (TBD) (remove (TBD))

SuggestedRemedy

Maximum link delay

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Resolved with comment#157

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **44**   Page 7 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:48 PM
SORT ORDER: Comment ID

Cl **146**　　　*SC* **146.7.1.3**　　　　*P* **115**　　　*L* **39**　　　# 45

Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **T**　　　*Comment Status* **A**　　　　　*Link Segment*

8834 ns (this value is calculated back from AWG14 cable insertion loss, thus estimating a maximum possible length of 1589 m with 5.6 ns per m; typically AWG14 cable has a higher RL than AWG18 cable, thus the IL is due to reflections at the MDI also higher and the possible reach is lower; suggestion is to calculate with a maximum link segment length of 1500 m with 5.6 ns per m, which leads to 8400 ns of maximum link delay time; when changing the maximum link delay time, also the timer values of Clause 98 have to be adopted accordingly, see therefore also presentation "Clause 98 Timer Values").

SuggestedRemedy

Define 8400 ns and change the low speed mode timer values mentioned in presentation "Clause 98 Timer Values" within the draft on pages 59 to 61 and in the respective PICS on pages 64 and 65.

Response　　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.
Add sentence under first paragraph.
The delay is derived from the point-to-point 14 AWG link segment length of 1589 m given in Table 200A-1 using Equation 80-1 with NVP of 0.6.

Change Clause 98 Timer Values within the draft on pages 59 to 61 and in the respective PICS on pages 64 and 65 according to http://www.ieee802.org/3/cg/public/Mar2018/Graber_3cg_03_0318.pdf for the link segment delay 8834 ns.

Cl **146**　　　*SC* **146.8.3**　　　　*P* **119**　　　*L* **8**　　　# 46

Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　*EZ*

Return loss (add (f) after Return loss, to align this Equation with other Equations with frequency dependency within this standard draft)

SuggestedRemedy

Return loss(f)

Response　　　　　*Response Status* **C**

ACCEPT.

Cl **146**　　　*SC* **146.1**　　　　*P* **121**　　　*L* **39**　　　# 47

Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　*EZ*

. current implementation on evaluation board takes about 20 bit times maximum). This is a reference to an example implementation, please remove this text.

SuggestedRemedy

Remove text "current implementation on evaluation board takes about 20 bit times maximum)"

Response　　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.
Remove the text "current implementation on evaluation board takes about 20 bit times maximum)"
AND
Remove the editor's note on lines 31 to 36 with similar content.

Cl **146**　　　*SC* **146.11.4.1.1**　　　*P* **124**　　　*L* **28**　　　# 48

Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　　*Comment Status* **A**　　　　　*EZ*

Convert Sdn[3:0] to ternary pair (replace pair by triplet (4B3T coding instead of 3B2T coding is being used for 10BASE-T1L))

SuggestedRemedy

Convert Sdn[3:0] to ternary triplet

Response　　　　　*Response Status* **C**

ACCEPT.

Cl **146**　　　*SC* **146.11.4.1.3**　　　*P* **126**　　　*L* **6**　　　# 49

Graber, Steffen　　　　　　　　Pepperl+Fuchs GmbH

Comment Type **T**　　　*Comment Status* **A**　　　　　*EZ*

The PCS shall be placed in loopback mode when the loopback bit in MDIO register 3.0.14, defined in 45.2.3.1.2 is set to a one. (There is an additional bit, 3.2278.14, which is defined in the PHY specific register set, with the same loopback functionality.)

SuggestedRemedy

The PCS shall be placed in loopback mode when the loopback bit in MDIO register 3.0.14, defined in 45.2.3.1.2, or the loopback bit in MDIO register 3.2278.14, defined in 45.2.3.58a.2, is set to a one.

Response　　　　　*Response Status* **C**

ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **49**

Page 8 of 37
3/6/2018 4:20:49 PM

Cl **146**　　*SC* **146.11.4.2.1**　　　*P* **126**　　*L* **37**　　　# 50
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　*Comment Status* **A**　　　　　　　*EZ*
146.4.2 (font size does not fit)

SuggestedRemedy
Align font size with rest of the text.

Response　　　　　*Response Status* **C**
ACCEPT.

Cl **146**　　*SC* **146.11.4.2.1**　　　*P* **126**　　*L*　　　# 51
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **T**　　*Comment Status* **A**　　　　　　　*EZ*
Contribute to the receive fault bit specified in 45.2.1.7.5 (PHY specific register is missing)

SuggestedRemedy
Contribute to the receive fault bit specified in 45.2.1.7.5 and 45.2.1.174b.7

Response　　　　　*Response Status* **C**
ACCEPT.

Cl **146**　　*SC* **146.11.4.2.2**　　　*P* **128**　　*L* **5**　　　# 52
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　*Comment Status* **A**　　　　　　　*EZ*
. by setting bits 1.2294.12 as . (change 'bits' to 'bit')

SuggestedRemedy
. by setting bit 1.2294.12 as .

Response　　　　　*Response Status* **C**
ACCEPT.

Cl **146**　　*SC* **146.11.4.2.2**　　　*P* **128**　　*L* **26**　　　# 53
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　*Comment Status* **A**　　　　　　　*EZ*
. for the 1 Vpp transmit amplitude . (everywhere else in the standards draft 1.0 Vpp is being used)

SuggestedRemedy
. for the 1.0 Vpp transmit amplitude .

Response　　　　　*Response Status* **C**
ACCEPT.

Cl **146**　　*SC* **146.11.4.6**　　　*P* **130**　　*L* **26**　　　# 54
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　*Comment Status* **A**　　　　　　　*EZ*
Less than 6.2 µs (64 bit times) (should be 6.4 µs instead of 6.2 µs)

SuggestedRemedy
Less than 6.4 µs (64 bit times)

Response　　　　　*Response Status* **C**
ACCEPT.

Cl **147**　　*SC* **147.2.2.2**　　　*P* **135**　　*L* **5**　　　# 55
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **E**　　*Comment Status* **A**　　　　　　　*EZ*
. if such error is detected, a ESDERR symbol is sent ..

SuggestedRemedy
. if this error is detected, then an ESDERR symbol is sent ..

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
Change "detected, a ESDERR" to "detected, an ESDERR"

Cl **146**　　*SC* **146A**　　　*P* **175**　　*L* **13**　　　# 56
Graber, Steffen　　　　　　　Pepperl+Fuchs GmbH

Comment Type **T**　　*Comment Status* **A**　　　　　　　*Safety*
As specific references in Annex 146A to other standards are critical to maintain, when the other standards change, they should be avoided and a more generic text should be used.

SuggestedRemedy
Replace text on page 175 by text provided in presentation "Intrinsically Safe Applications".

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
Replace text on page 175 Lines 12-34 (the entire body text) with text on slide 2 of presentation Graber_3cg_04_0318.pdf. With the following changes:
Change "Nevertheless the chosen 10BASE-T1L specification eases the realization of intrinsically safe systems." to "Nevertheless the specification of 10BASE-T1L in Clause 146 is intended to be compatible with implementation of intrinsically safe systems."

Change "A PHY with the following options would be beneficial:"
to "The following implementation choices can simplify the process for certifying 10BASE-T1L PHYs in intrinsically safe systems:"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **56**　　　Page 9 of 37
3/6/2018 4:20:49 PM

Cl **00**   *SC*   *P* **3**   *L* **1**   # 57
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **A**   *EZ*
. specifies additions to and appropriate modifications to add 10 Mb/s . (remove 'to' after 'additions')

SuggestedRemedy
. specifies additions and appropriate modifications to add 10 Mb/s .

Response   *Response Status* **C**
ACCEPT. Replace "specifies additions to and" with "specifies additions and"

Cl **00**   *SC*   *P* **3**   *L* **4**   # 58
Graber, Steffen   Pepperl+Fuchs GmbH

Comment Type **E**   *Comment Status* **R**   *EZ*
copper (in Keywords section most of the words start with a capital letter, should be uniform)

SuggestedRemedy
Copper

Response   *Response Status* **C**
REJECT. Chief Editor confirmed with Pete Anslow that previous practice has not been to capitalize all of the entries in the keywords (see "copper" in the 802.3bw Keyword list, for example).

Cl **00**   *SC* **0**   *P* **11**   *L* **48**   # 59
Maguire, Valerie   The Siemon Company

Comment Type **E**   *Comment Status* **A**   *EZ*
There are two companion documents. Pete Anslow has provided proposed text.

SuggestedRemedy
Replace, "A companion document IEEE Std 802.3.2 defines YANG modules for legacy shared (CSMA/CD) and dedi-cated links in point-to-point and point-to-multipoint architectures (Ethernet Passive Optical Networks, EPON), as well as Power over Ethernet (PoE) ports." with "Two companion documents exist, IEEE Std 802.3.1 and IEEE Std 802.3.2. IEEE Std 802.3.1 describes Ethernet management information base (MIB) modules for use with the Simple Network Management Protocol (SNMP). IEEE Std 802.3.2 describes YANG data models for Ethernet. IEEE Std 802.3.1 and IEEE Std 802.3.2 are updated to add management capability for enhancements to IEEE Std 802.3 after approval of those enhancements."

Response   *Response Status* **C**
ACCEPT. Replace, "A companion document IEEE Std 802.3.2 defines YANG modules for legacy shared (CSMA/CD) and dedi-cated links in point-to-point and point-to-multipoint architectures (Ethernet Passive Optical Networks, EPON), as well as Power over Ethernet (PoE) ports." with "Two companion documents exist, IEEE Std 802.3.1 and IEEE Std 802.3.2. IEEE Std 802.3.1 describes Ethernet management information base (MIB) modules for use with the Simple Network Management Protocol (SNMP). IEEE Std 802.3.2 describes YANG data models for Ethernet. IEEE Std 802.3.1 and IEEE Std 802.3.2 are updated to add management capability for enhancements to IEEE Std 802.3 after approval of those enhancements."

Cl **00**   *SC* **0**   *P* **11**   *L* **26**   # 60
Maguire, Valerie   The Siemon Company

Comment Type **E**   *Comment Status* **A**   *EZ*
It's recommended to flag the new frontmatter text with an editor's note so that this material will be sure to be reviewed when the document goes out for Working Group review.

SuggestedRemedy
Insert Editors note with the text, "Editor's Note: New front matter text needs review."

Response   *Response Status* **C**
ACCEPT. Insert Editors note with the text, "Editor's Note: New front matter text needs review."

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **60**   Page 10 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **146**	*SC* **146.7.1.4**	*P* **115**	*L* **42**	# 61

Maguire, Valerie   The Siemon Company

Comment Type **T** *Comment Status* **A**   *Link Segment*

Be clear that the parameter of differential to common mode conversion applies to unshielded cabling only.

SuggestedRemedy

Change the sub-clause header from, "146.7.1.4 Differential to common mode conversion" to "146.7.1.4 Differential to common mode conversion (unshielded only)".

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.

Modify first sentence to be explicit that 146.7.1.4 applies to unshielded link segments.

The differential to common mode conversion requirement applies to unshielded link segments and depends on the electromagnetic noise environment.

Cl **146**	*SC* **146.7.1.4**	*P* **115**	*L* **43**	# 62

Maguire, Valerie   The Siemon Company

Comment Type **T** *Comment Status* **A**   *Link Segment*

Align the structure of the first sentence in clause 146.7.1.4 with the first sentence of 146.7.1.5.

SuggestedRemedy

Replace, "requirements of unshielded link segments" with "requirements of the unshielded link segment".

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.

Resolved with comment#61

Cl **146**	*SC* **146.7.1.5**	*P* **116**	*L* **13**	# 63

Maguire, Valerie   The Siemon Company

Comment Type **T** *Comment Status* **A**   *Link Segment*

Be clear that the parameter of coupling attenuation applies to shielded cabling only.

SuggestedRemedy

Change the sub-clause header from, "146.7.1.5 Coupling attenuation" to "146.7.1.5 Coupling attenuation (shielded only)" and change the text on line 14 from "of the link segment" to "of the shielded link segment".

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.

Modify first sentence to be explicit that 146.7.1.5 applies to unshielded link segments.

The coupling attenuation requirement applies to shielded link segments and depends on the electromagnetic noise environment.

Cl **00**	*SC* **0**	*P* **11**	*L* **36**	# 64

Maguire, Valerie   The Siemon Company

Comment Type **E** *Comment Status* **A**   *EZ*

Overview of amendment is incorrect. Update with new text provided by David Law.

SuggestedRemedy

Replace, "This amendment increases the maxi-mum PD power available by utilizing all four pairs in the specified structured wiring plant." with "This amendment adds power delivery using all four pairs in the structured wiring plant, resulting in greater power being available to end devices. This amendment also allows for lower standby power consumption in end devices and adds a mechanism to better manage the available power budget."

Response   *Response Status* **C**

ACCEPT. Replace, "This amendment increases the maxi-mum PD power available by utilizing all four pairs in the specified structured wiring plant." with "This amendment adds power delivery using all four pairs in the structured wiring plant, resulting in greater power being available to end devices. This amendment also allows for lower standby power consumption in end devices and adds a mechanism to better manage the available power budget."

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **64**   Page 11 of 37
3/6/2018 4:20:49 PM

Cl **00** *SC* **0** *P* **11** *L* **41** # 65
Maguire, Valerie The Siemon Company

Comment Type **E** *Comment Status* **A** *EZ*
Overview of amendment is incorrect. Update with new text provided by David Law.

SuggestedRemedy
Replace, "This amendment includes changes to IEEE Std 802.3-201x and its amendments, and adds Clause 136 through Clause 140, Annex 135A, Annex 135B, Annex 135C, Annex 135D, Annex 135E, Annex 135F, Annex 135G, Annex 136A, Annex 136B, Annex 136C, and Annex 136D. This amendment adds new Media Access Control (MAC) parameters, Physical Layer specifications, and management parameters for the transfer of IEEE 802.3 format frames at 50 Gb/s, 100 Gb/s, and 200 Gb/s." with "This amendment includes changes to IEEE Std 802.3-201x and its amendments, and adds Clause 131 through Clause 140 and Annex 135A through Annex 136D. This amendment adds MAC parameters, Physical Layers, and management parameters for the transfer of IEEE 802.3 format frames at 50 Gb/s, 100 Gb/s, and 200 Gb/s."

Response *Response Status* **C**
ACCEPT. Replace, "This amendment includes changes to IEEE Std 802.3-201x and its amendments, and adds Clause 136 through Clause 140, Annex 135A, Annex 135B, Annex 135C, Annex 135D, Annex 135E, Annex 135F, Annex 135G, Annex 136A, Annex 136B, Annex 136C, and Annex 136D. This amendment adds new Media Access Control (MAC) parameters, Physical Layer specifications, and management parameters for the transfer of IEEE 802.3 format frames at 50 Gb/s, 100 Gb/s, and 200 Gb/s." with "This amendment includes changes to IEEE Std 802.3-201x and its amendments, and adds Clause 131 through Clause 140 and Annex 135A through Annex 136D. This amendment adds MAC parameters, Physical Layers, and management parameters for the transfer of IEEE 802.3 format frames at 50 Gb/s, 100 Gb/s, and 200 Gb/s."

Cl **147** *SC* **147.4.1.3.2** *P* **147** *L* **29** # 66
Maguire, Valerie The Siemon Company

Comment Type **E** *Comment Status* **A** *EZ*
Typo

SuggestedRemedy
Replace, "UppePSD" with "UpperPSD" in equation (147-1).

Response *Response Status* **C**
ACCEPT.
Change "UppePSD(f)" to "UpperPSD(f)" in the equation

Cl **147** *SC* **147.6.3** *P* **150** *L* **29** # 67
Maguire, Valerie The Siemon Company

Comment Type **E** *Comment Status* **A** *EZ*
Capitalization error

SuggestedRemedy
Replace, "ModeconversionLoss" with "ModeConversionLoss" in equation (147-5).

Response *Response Status* **C**
ACCEPT.

Cl **146** *SC* **146.7.1.1** *P* **114** *L* **20** # 68
Horrmeyer, Bernd Phoenix Contact

Comment Type **ER** *Comment Status* **A** *EZ*
Graph starts at approximately 5 dB. Smallest value when calculating insertion loss by Equation (146-14) is 10.3 dB

SuggestedRemedy
Change the smallest value of the graph to 10.3 dB

Response *Response Status* **C**
ACCEPT IN PRINCIPLE.

Resolved with comment#156

Cl **146** *SC* **146.7.1.2** *P* **115** *L* **8** # 69
Horrmeyer, Bernd Phoenix Contact

Comment Type **T** *Comment Status* **R** *Link Segment*
Why does specified range starts at 0.1 MHz? When measuring in such a low frequency range, measuring dynamics can become crucial

SuggestedRemedy
If the frequency range is necessary, specify it but do not require a measurement at low frequencies

Response *Response Status* **C**
REJECT.

The 10BASE-T1L PHY is designed to operate over single balanced twisted-pair cabling that meets the link segment requirements. The link segment specification does not include measurement specifications.

The frequency range is specified to sufficiently characterize link segment performance to support 3 level Pulse Amplitude Modulation (PAM3) transmitted at 7.5 MBd with a Tx PSD specified from fMhz=0 to fMhz=20 MHz.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **69** Page 12 of 37
3/6/2018 4:20:49 PM

Cl **146**   *SC* **146.8.3**   *P* **119**   *L* **8**   # 70

Horrmeyer, Bernd   Phoenix Contact

Comment Type **TR**   *Comment Status* **A**   *MDI*

Formula 146-16 results in negative value for maximum frequency of 20 MHz

SuggestedRemedy

correct formula

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Add to editor's note on line 13:
"Return loss value becomes negative at 20 MHz - proposals needed to modify this"

Cl **146**   *SC* **146.7.1.2**   *P* **114**   *L* **49**   # 71

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **A**   *Link Segment*

Editors note:

SuggestedRemedy

If agreed match values below 1 MHz to: 15 dB down to 0.6 MHz; 9+10f from .1 to .6 MHz

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Resolved with comment#72.

Cl **146**   *SC* **146.7.1.2**   *P* **114**   *L* **49**   # 72

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **A**   *Link Segment*

Editors note:

SuggestedRemedy

If not agreed the comment presented for draft 1.0 should be adaptet to change Rl between 10 to 20 MHz from 19 to 24-5log(f)

Response   *Response Status* **C**

ACCEPT. Equation and figure slide 5 of cited presentation diminico_01_0318.pdf .

Cl **146**   *SC* **146.7.1.6**   *P* **116**   *L* **42**   # 73

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **R**   *Link Segment*

Table 146-7 shows some TBD , and comments before relating that values need to be found. If We refer to the MICE Table with the known E1, E2, and E3 the values are given in international Standards.If we want other values we cannot call them Ex anymore.

SuggestedRemedy

Leave the table as in Draft 1.0 and add the rows with static discharge and transient burst. It was mentioned in Geneva that they were missing. Add a note below the Table note:There is a transition below 100 MHz in measurements because it gets unrealistic to measure down to .1 MHz; it would need setups in the 100m range. For coupling attenuation and shielding effectiviness it can be assumed that the limits below 30 MHz will never be lower. For differential to commen mode conversion it is similar because the values are measurend usually at short lenght.

Response   *Response Status* **C**

REJECT.

The note on P115, L50 states, the basis for coupling attenuation TBDs for the electromagnetic environment are not adequately specified
(TBD) for the link segment frequency range 0.1 MHz-20 MHz.

In 8023cg_D1p0.pdf the Table 146-8-Electromagnetic classiesfications 10BASE-T1L link segment for Radiated RF - AM are specified from 80 MHz.

Regarding static discharge and transient burst, be explicit in additions to the table and rationale.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **73**   Page 13 of 37
3/6/2018 4:20:49 PM

Cl **146**　　*SC* **146.7.1.4**　　　　*P* **115**　　*L* **50**　　　# 74
Schicketanz, Dieter　　　　　　　Reutlingen University

Comment Type **T**　　*Comment Status* **A**　　　　*Link Segment*

editors notes on page 115,116

SuggestedRemedy

Delete editors notes and replace Tables 146-5 and 146-6 with the values presented in Schicketanz_122017_10SPE_01_adhoc.pdf pages 7 and 8

Response　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.

Adopt table slide 9 of diminico_01_0318.pdf without TBDs for TCL and change 60 to 63 and remove one "-".

For ELTCTL use the TCL in table slide 9 in diminico_01_0318.pdf and the 146.7.1.1 Insertion loss to derive the limit for ELTCTL.

Add editors note. The proposed table values are based on cabling measurements that need to be aligned with the electromagnetic classifications Table 146-7.

Cl **146**　　*SC* **146.7.2.3**　　　　*P* **117**　　*L* **41**　　　# 75
Schicketanz, Dieter　　　　　　　Reutlingen University

Comment Type **E**　　*Comment Status* **A**　　　　*Link Segment*

There is a change in alien FEXT specification. Till now IEEE802.3 specified PSAACR-F. For the first time now PSAFEXT limit is specified. The advantage is that no power backoff is necesary anymore but puts the burden on the components and installation.

SuggestedRemedy

To avoid misunderstandings this should be mentiond with a note after the introduction at line 45. Note: This is an improved definition not to be confused with PSAACR-F.

Response　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.

Add sentence to paragraph P117, L45.

Note that the MDAFEXT is specified as the power sum of the individual alien FEXT disturbers (PSAFEXT) and not individual alien ACRF disturbers (PSAACR-F).

Cl **146**　　*SC* **146.8.1**　　　　*P* **118**　　*L* **28**　　　# 76
Schicketanz, Dieter　　　　　　　Reutlingen University

Comment Type **T**　　*Comment Status* **A**　　　　*MDI*

MDI Connectors. Liaison letters were send out to this subject. Responses should be included in the discussion.

SuggestedRemedy

Responses should be included in the discussion before making decisions.

Response　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.
No change to draft

Cl **147**　　*SC* **147.6**　　　　*P* **150**　　*L* **1**　　　# 77
Schicketanz, Dieter　　　　　　　Reutlingen University

Comment Type **T**　　*Comment Status* **A**　　　　*Link Segment*

There are no link specifications for multidrop, link lenght and number of connections are missing also. 25m with 8 drops is a challenging target.

SuggestedRemedy

As the values till now are the same for both add in the Title multidrop. Add below that the link lenght is 15 m and number of connections is 4 for point-to-point and 25m and no additional connections for multidrop. Introductory words like in T1L page 113 would be useful . (no additional conneccions means that only the drops will disturb)

Response　　　　*Response Status* **C**

ACCEPT IN PRINCIPLE.

The 147 link segment subclause needs structure similar 146 as well as the addition of MDI and environmental subclause consistent with structure of 146.

Editor given license to implement.

Motion: Move that the IEEE P802.3cg Task Force accept slide 5 of jonesyseboodt_3cg_01a_0318.pdf as an additional resolution to comment 77
Editor note: this motion changes the MDI fault sections: 146.8.4 and 147.8.3

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **77**　　　Page 14 of 37
3/6/2018 4:20:49 PM

Cl **147**   *SC* **147.6**   *P* **150**   *L* **36**   # 78

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **A**   *Link Segment*

The complete clause needs some wording and explanations for mode conversion and limits for Alien Noise.

SuggestedRemedy

Rewrite the complete clause using 802.3bw clause 147.6 as guidance (adding alien noise).

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE. Resolved with comment#77.

Cl **147**   *SC* **147.6**   *P* **150**   *L* **52**   # 79

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **A**   *Link Segment*

MDI Clause missing

SuggestedRemedy

copy MDI clause 96.8 from 802.3bw

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE. Resolved with comment#77.

Cl **147**   *SC* **147.6**   *P* **150**   *L* **52**   # 80

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **A**   *Link Segment*

Envinronmental specification clause missing

SuggestedRemedy

copy clause 96.9 from 802.3bw

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE. Resolved with comment#77.

Cl **200**   *SC* **200A.1**   *P* **179**   *L* **1**   # 81

Schicketanz, Dieter   Reutlingen University

Comment Type **T**   *Comment Status* **R**   *Link Segment*

Annex 200 contains useful information but they are informative. Only clause 200A.1.1.1.2 could be considered normative . It was discussed like this in Geneva

SuggestedRemedy

Change Normative to informative , and if necesary delete clause 200A.1.1.1.2 and insert in the main body as subclause 146.7.2.4 (link performance)

Response   *Response Status* **C**

REJECT.

The Annex includes requirements for class power (normative) and associated PICS.

200A.1.1.1.2 Point-to-point class power requirements
The minimum continuous power that the PSE shall be capable of supplying (Ppd) for the 1000 m link segment
is given inTable 200A-2 for each class.

Cl **146**   *SC* **146.10**   *P* **121**   *L* **39**   # 82

Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *Delay*

Delete "current implementation on evaluation board takes about 20 bit times maximum) "

SuggestedRemedy

Delete "current implementation on evaluation board takes about 20 bit times maximum) "

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Delete "current implementation on evaluation board takes about 20 bit times maximum) "
as per comment, as well as Editor's note at lines 31-35.

Cl **147**   *SC* **147.2**   *P* **133**   *L* **6**   # 83

Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *EZ*

change "plca_en signal" to "plca_en"

SuggestedRemedy

change "plca_en signal" to "plca_en"

Response   *Response Status* **C**

ACCEPT.
Change "plca_en signal" to "plca_en"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **83**   Page 15 of 37
3/6/2018 4:20:49 PM

Cl **147**   *SC* **147.2.2**   *P* **138**   *L* **10**   # 84
Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *State Diagram*
   In Figure 147-4 "transmitting <= ENCODE(pcs_txdn)" in the DATA state is wrong.

SuggestedRemedy
   change "transmitting <= ENCODE(pcs_txdn)" to "tx_sym <= ENCODE(pcs_txdn)"

Response   *Response Status* **C**
   ACCEPT.
   Change "transmitting" to "tx_sym"

Cl **147**   *SC* **147.2.2**   *P* **138**   *L* **13**   # 85
Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *State Diagram*
   The condition to keep in DATA state is not clear

SuggestedRemedy
   Add "ELSE" on the transtion from DATA to DATA itself.

Response   *Response Status* **C**
   ACCEPT IN PRINCIPLE.
   - 147-3: Arrow connecting "SILENT" to "SYNC1" should have the label "STD * pcs_txen =
   TRUE"
   - 147-3: Arrow connecting "SILENT" to "SILENT" should have the label "STD * pcs_txen =
   FALSE"
   - 147-4: Arrow connecting "DATA" to "ESD" should have the label "STD * pcs_txen =
   FALSE"
   - 147-4: Arrow connecting "DATA" to "DATA" should have the label "STD * pcs_txen =
   TRUE"

Cl **147**   *SC* **147.2.2**   *P* **138**   *L* **29**   # 86
Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *State Diagram*
   Missed STD on the transition from GOOD_ESD to SILENT

SuggestedRemedy
   Add "STD" on the transition from GOOD_ESD to SILENT

Response   *Response Status* **C**
   ACCEPT.
   Add "STD" on the transition from "GOOD_ESD" to "SILENT"

Cl **147**   *SC* **147.2.3**   *P* **139**   *L* **12**   # 87
Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *Editorial*
   SILENCE is also defined in 147.2.2.1, should be included here

SuggestedRemedy
   Change "For the definition of pcs_reset, SYNC, ." to "For the definition of pcs_reset,
   SILENCE, SYNC, ."

Response   *Response Status* **C**
   ACCEPT IN PRINCIPLE.
   - Change "For the definition of pcs_reset, SYNC" to "For the definition of pcs_reset,
   SILENCE, SYNC"
   - Change "147.2.2.1 and following." to "147.2.2.2."
   Note the change of 1 to 2

Cl **147**   *SC* **147.2.3.1**   *P* **139**   *L* **32**   # 88
Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *PCS*
   SILENCE has already been defined in 147.2.2.1

SuggestedRemedy
   Delete "SILENCE" variable definition.

Response   *Response Status* **C**
   ACCEPT IN PRINCIPLE.
   Already dealt with by #87

Cl **147**   *SC* **147.2.3.2**   *P* **139**   *L* **37**   # 89
Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *State Diagram*
   sym_rx is not defined, should be RX

SuggestedRemedy
   Change "sym_rx" to "RX"

Response   *Response Status* **C**
   ACCEPT.
   Change "sym_rx" to "RX"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **89**   Page 16 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **147**   *SC* **147.2.3**   *P* **140**   *L* **19**   # **90**

Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *Editorial*

Rxn-4 is not consistant with "RX" variable definition

SuggestedRemedy

Change Rxn-4 to RXn-4; search other Rxs in Figure 147-5 and replace them with RXs

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Change <all> case sensitive pattern "Rxn" to "RXn" to keep consistentcy of the clause.
Note: at the time of comment resolution 8 occurrences were found

---

Cl **147**   *SC* **147.2.3**   *P* **140**   *L* **19**   # **91**

Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *EZ*

rx_data<2:0> is wrong, should be rx_data<3:0>

SuggestedRemedy

Change rx_data<2:0> to rx_data<3:0>

Response   *Response Status* **C**

ACCEPT.
Change "rx_data<2:0>" to "rx_data<3:0>"

Cl **147**   *SC* **147.2.3**   *P* **140**   *L* **27**   # **92**

Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *EZ*

rx_data<2:0> is wrong, should be rx_data<3:0>

SuggestedRemedy

Change rx_data<2:0> to rx_data<3:0>

Response   *Response Status* **C**

ACCEPT.
Change "rx_data<2:0>" to "rx_data<3:0>"

Cl **148**   *SC* **148.4.4.1.1**   *P* **159**   *L* **35**   # **93**

Xu, Dayin   Rockwell Automation

Comment Type **T**   *Comment Status* **A**   *EZ*

This sub-clause is only about the BEACON request, not about the BEACON indication.

SuggestedRemedy

Change the title from "BEACON request and indication" to "BEACON request"

Response   *Response Status* **C**

ACCEPT.
Change the title from "BEACON request and indication" to "BEACON request"

Cl **146**   *SC* **146.1**   *P* **79**   *L* **19**   # **94**

Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *EZ*

Missed a space between 10BASE-T1L and PHY

SuggestedRemedy

Add a space between 10BASE-T1L and PHY

Response   *Response Status* **C**

ACCEPT. (duplicate of comment 11)

Cl **146**   *SC* **146.1.2.1**   *P* **81**   *L* **24**   # **95**

Xu, Dayin   Rockwell Automation

Comment Type **E**   *Comment Status* **A**   *EZ*

wrong format

SuggestedRemedy

remove spaces between "signa" and "ls on ..."

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Accomplished by resolution of comment 11

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **95**   Page 17 of 37
3/6/2018 4:20:49 PM

Cl **146**   *SC* **146.2**   *P* **82**   *L* **28**   # 96

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *EZ*

TXD<7:0> should be TXD<3:0>

SuggestedRemedy

Change TXD<7:0> to TXD<3:0>

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.2**   *P* **82**   *L* **27**   # 97

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *EZ*

RXD<7:0> should be RXD<3:0>

SuggestedRemedy

Change RXD<7:0> to RXD<3:0>

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.8.4**   *P* **119**   *L* **24**   # 98

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *MDI*

10BASE-T1L is not for automotive application, so the paragraph " For automotive applications . is/are removed" should be removed.

SuggestedRemedy

Remove the paragraph of " For automotive applications . is/are removed".

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.9.2**   *P* **120**   *L* **25**   # 99

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *Safety*

10BASE-T1L is not for automotive application, so the sentence " in automotive applications, all 10BASE-T1L . , and ISO 15764" should be removed.

SuggestedRemedy

Remove the sentence " in automotive applications, all 10BASE-T1L . , and ISO 15764".

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.9.2.1**   *P* **120**   *L* **38**   # 100

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *Safety*

10BASE-T1L is not for automotive application, so the paragraph " In automotive applications, all . e) Chemical loads: ISO 167540-5 and ISO 20653" should be removed.

SuggestedRemedy

Remove the paragraph " In automotive applications, all . e) Chemical loads: ISO 167540-5 and ISO 20653" (line 38 - line 45).

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.9.2.2**   *P* **121**   *L* **18**   # 101

Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *Safety*

10BASE-T1L is not for automotive application, so the paragraph " In automotive applications, . ISO 7637-2/3" from line 18 to line 25 should be removed.

SuggestedRemedy

Remove the paragraph " In automotive applications, . ISO 7637-2/3" from line 18 to line 25

Response   *Response Status* **C**

ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **101**   Page 18 of 37
3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.4.1.2**   *P* **159**   *L* **50**   # 102
Xu, Dayin   Rockwell Automation

Comment Type   **T**   *Comment Status* **A**   *EZ*
   This sub-clause is only about the COMMIT request, not about the COMMIT indication.

SuggestedRemedy
   Change the title from COMMIT request and indication" to COMMIT request"

Response   *Response Status*   **C**
   ACCEPT.
   Change the title from COMMIT request and indication" to COMMIT request"

Cl **148**   *SC* **148.4.4.2.1**   *P* **160**   *L* **25**   # 103
Xu, Dayin   Rockwell Automation

Comment Type   **E**   *Comment Status* **A**   *Editorial*
   text changes proposed

SuggestedRemedy
   Change "When the PHY receives a BEACON indication from the master, it shall convery
   this information to the RS by asserting MII signals ." to "When the PHY receives a
   BEACON request from the master PHY, it shall indicate this information to the RS by
   asserting MII signals ."

Response   *Response Status*   **C**
   ACCEPT.

   BEACON request is generated by RS via MII to have the PHY to send BEACON on the line.

   BEACON indication is generated by the PHY via MII to notify the RS that a BEACON is
   being received

   EDITOR: Change "When the PHY receives a BEACON indication from the master, it shall
   convey this information to the RS by asserting MII signals ." to "When the PHY receives a
   BEACON, it shall indicate this information to the RS by asserting MII signals"

Cl **148**   *SC* **148.4.4.2.2**   *P* **160**   *L* **34**   # 104
Xu, Dayin   Rockwell Automation

Comment Type   **E**   *Comment Status* **A**   *Editorial*
   text changes proposed

SuggestedRemedy
   Change "When the PHY receives a COMMIT indication from another PHY, it shall convery
   this information to the RS by asserting MII signals ." to "When the PHY receives a
   COMMIT request from another PHY, it shall indicate this information to the RS by asserting
   MII signals ."

Response   *Response Status*   **C**
   ACCEPT IN PRINCIPLE.

   COMMIT request is generated by RS via MII to have the PHY to send COMMIT on the line.

   COMMIT indication is generated by the PHY via MII to notify the RS that a COMMIT is
   being received

   Change "When the PHY receives a COMMIT indication from another PHY, it shall convey
   this information to the RS by asserting MII signals" to "When the PHY receives a COMMIT
   from the line, it shall indicate this information to the RS by asserting MII signals"

Cl **148**   *SC* **148.4.5.1**   *P* **161**   *L* **50**   # 105
Xu, Dayin   Rockwell Automation

Comment Type   **E**   *Comment Status* **A**   *Editorial*
   text changes proposed

SuggestedRemedy
   Change "assumes the indication of the PHY ." to "assumes the early receive indication of
   the PHY ."

Response   *Response Status*   **C**
   ACCEPT.
   Change "assumes the indication of the PHY" to "assumes the early receive indication of
   the PHY"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **105**   Page 19 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **147**	*SC* **147.2.2.1**	*P* **133**	*L* **52**	# 106

Huszák, Gergely   Kone

Comment Type **E**   *Comment Status* **A**   State Diagram

The term "SSD symbol group" is incorrect (SSD is a standalone 5B symbol, not a group of those). Moreover the wording does not harmonize with the rest of the clause

SuggestedRemedy

Change "one SSD symbol group" to "an SSD"

Response   *Response Status* **C**

ACCEPT.
Change "one SSD symbol group" to "an SSD"
Note: this is editor's own comment, rooted in a discussion directly following D1.0 resolution

---

Cl **147**	*SC* **147.2.3**	*P* **139**	*L* **2**	# 107

Huszák, Gergely   Kone

Comment Type **E**   *Comment Status* **A**   Editorial

The term "the SSD symbol" does not harmonize with the rest of the clause

SuggestedRemedy

Change "the SSD symbol" to "an SSD"

Response   *Response Status* **C**

ACCEPT.
Change "the SSD symbol" to "an SSD"
Note: this is editor's own comment, rooted in a discussion directly following D1.0 resolution

---

Cl **147**	*SC* **147.2.5**	*P* **142**	*L* **18**	# 108

Huszák, Gergely   Kone

Comment Type **E**   *Comment Status* **A**   Editorial

The term "SSD symbol" does not harmonize with the rest of the clause

SuggestedRemedy

Change "SSD symbol" to "SSD"

Response   *Response Status* **C**

ACCEPT.
Change "the SSD symbol" to "an SSD"
Note: this is editor's own comment, rooted in a discussion directly following D1.0 resolution

---

Cl **147**	*SC* **147.2.1**	*P* **133**	*L* **1**	# 109

Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   EZ

Comment #267 on draft 1.0 was approved but not fully implemented in draft 1.1

SuggestedRemedy

In figure 147-2 change "plca_en signal" arrow (from MANAGEMENT to PCS TRANSMIT block) to "plca_en"

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Already dealt with by #83

Cl **147**	*SC* **147.2.1**	*P* **133**	*L* **1**	# 110

Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   EZ

In figure 147-2 the MII signals should be named as in clause 22

SuggestedRemedy

replace "TXCLK" with "TX_CLK", replace "RXCLK" with "RX_CLK", replace "RXDV" with "RX_DV", replace "RXER" with "RX_ER"

Response   *Response Status* **C**

ACCEPT.
- Replace "TXCLK" with "TX_CLK"
- Replace "RXCLK" with "RX_CLK"
- Replace "RXDV" with "RX_DV"
- Replace "RXER" with "RX_ER"

Cl **147**	*SC* **147.2.2.3**	*P* **138**	*L* **20**	# 111

Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   State Diagram

In figure 147-4 some errors occurred when porting the picture to Frame from draft 1.0

SuggestedRemedy

In figure 147-4 substitute "STD err = TRUE" with "STD * err = TRUE" in all transitions from ESD state; add "STD" in transition from GOOD_ESD to "B". See attached PDF.

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
- Change 2 times "STD <NL> err =" to STD * err ="
Note: second part of the comment has already been dealt with by #86

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **111**   Page 20 of 37
3/6/2018 4:20:49 PM

Cl **147**	*SC* **147.2.2.3**	*P* **138**	*L* **11**	# 112

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*EZ*

In figure 147-4 in DATA state, pcs_txen is a typo. It should be pcs_txer.

SuggestedRemedy

In figure 147-4 replace "err <= err + pcs_txen" with "err <= err + pcs_txer"

Response	*Response Status* **C**

ACCEPT.
Change "err <= err + pcs_txen" to "err <= err + pcs_txer"

Cl **147**	*SC* **147.2.3.3**	*P* **140**	*L* **1**	# 113

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*State Diagram*

Multiple errors occurred when porting figure 147-5 to Frame from draft 1.0

SuggestedRemedy

In state WAIT_SYNC add space between pcs_rxd and <= symbol. See attached PDF.
Replace text in state WAIT_SSD with text in draft 1.0. See attached PDF.
Replace text in state PRE1 with text in draft 1.0. See attached PDF.
In transition from BAD_SSD state to WAIT_SYNC state replace the "RXn != SILENCE"
with "RXn = SILENCE".
From all state when entering WAIT_SYNC state replace "<=" assignment symbol with "="
comparison symbol.

Response	*Response Status* **C**

ACCEPT IN PRINCIPLE.
Make all changes highlighted on slide 6/17 of beruto_3cg_03_0318.pdf

Cl **147**	*SC* **147.2.3.3**	*P* **141**	*L* **1**	# 114

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*State Diagram*

Multiple errors occurred when porting figure 147-6 to Frame from draft 1.0

SuggestedRemedy

Add text in state DATA copying from draft 1.0. See attached PDF.

Response	*Response Status* **C**

ACCEPT.
Make all changes highlighted on slide 8/17 of beruto_3cg_03_0318.pdf

Cl **147**	*SC* **147.3.2**	*P* **145**	*L* **18**	# 115

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*State Diagram*

Figure 147-8 porting from draft 1.0 is incomplete

SuggestedRemedy

Copy figure from draft 1.0. See attached PDF

Response	*Response Status* **C**

ACCEPT IN PRINCIPLE.
- Add a center-aligned "x x x" to the "DATA" state of DME TX"
- Add the 4 missing horizontal bars being part of the
Note: See/use "Figure 0-5" of "8023_lewis_figs_0p8.pdf"

Cl **147**	*SC* **147.5.1.2**	*P* **149**	*L* **17**	# 116

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*PMD*

Figure 147-11 porting from draft 1.0 is incomplete

SuggestedRemedy

Copy figure from draft 1.0. See attached PDF

Response	*Response Status* **C**

ACCEPT.
- Add "stub1" to the top-right side of the left stup
- Add "stub2" to the top-right side of the right stup
Note: See/use "Figure 0-7" of "8023_lewis_figs_0p8.pdf"

Cl **148**	*SC* **148.4.2**	*P* **157**	*L* **8**	# 117

Beruto, Piergiorgio	Canova Tech

Comment Type **E**	*Comment Status* **A**	*EZ*

In figure 148-2 the MII signals should be named as in clause 22

SuggestedRemedy

replace "TXCLK" with "TX_CLK", replace "TXEN" with "TX_EN", replace "TXER" with
"TX_ER"

Response	*Response Status* **C**

ACCEPT.
In figure 148-2 replace "TXCLK" with "TX_CLK", replace "TXEN" with "TX_EN", replace
"TXER" with "TX_ER"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general	*Comment ID* **117**	Page 21 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected	RESPONSE STATUS: O/open W/written C/closed Z/withdrawn	3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **148**　　*SC* **148.4.5.1**　　　*P* **164**　　*L* **12**　　　# 118
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　　*Comment Status* **A**　　　　*Editorial*
　　In figure 148-4 variable "framePending" should be renamed to "packetPending"

SuggestedRemedy
　　In figure 148-4 replace all occurrences of "framePending" with "packetPending"

Response　　　　　*Response Status* **C**
　　ACCEPT.
　　In figure 148-4 replace all occurrences of "framePending" with "packetPending"

Cl **148**　　*SC* **148.4.5.1**　　　*P* **164**　　*L* **46**　　　# 119
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　　*Comment Status* **A**　　　　*Editorial*
　　In transition from "NEXT_TS" state to "WAIT_TO" state there should be an "ELSE"

SuggestedRemedy
　　In figure 148-4 add "ELSE" to transition between NEXT_TS state to WAIT_TO state

Response　　　　　*Response Status* **C**
　　ACCEPT.
　　In figure 148-4 add "ELSE" to transition between NEXT_TS state to WAIT_TO state

Cl **148**　　*SC* **148.4.5.1**　　　*P* **164**　　*L* **46**　　　# 120
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　　*Comment Status* **A**　　　　*PLCA*
　　NEXT_TS state should be named NEXT_TO (which stands for NEXT Transmit Opportunity)

SuggestedRemedy
　　In figure 148-4 replace NEXT_TS with NEXT_TO

Response　　　　　*Response Status* **C**
　　ACCEPT IN PRINCIPLE.
　　In figure 148-4 change "NEXT_TS" to "NEXT_TX_OPPORTUNITY"

Cl **148**　　*SC* **148.4.6.1**　　　*P* **168**　　*L* **1**　　　# 121
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　　*Comment Status* **A**　　　　*Editorial*
　　Figure 148-5 should be updated integrating changes in the yellow boxes

SuggestedRemedy
　　Replace figure 148-5 as in attached PDF

Response　　　　　*Response Status* **C**
　　ACCEPT IN PRINCIPLE.
　　Replace figure 148-5 as in Beruto_3cg_01_0318.pdf

Cl **148**　　*SC* **148.4.6.1**　　　*P* **168**　　*L* **1**　　　# 122
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　　*Comment Status* **A**　　　　*Editorial*
　　Text formatting in figure 148-5 is not clear.

SuggestedRemedy
　　in figure 148-5 substitute "SIGNAL_STATUS ?
　　SIGNAL_ERROR if COL = TRUE
　　NO_SIGNAL_ERROR else" with "if COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR
　　else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

　　substitute "CARRIER_STATUS ?
　　CARRIER_ON if plca_crs = TRUE
　　CARRIER_OFF else" with "if plca_CRS = TRUE CARRIER_STATUS <= CARRIER_ON
　　else CARRIER_STATUS <= CARRIER_OFF"

Response　　　　　*Response Status* **C**
　　ACCEPT.
　　in figure 148-5 substitute "SIGNAL_STATUS ?
　　SIGNAL_ERROR if COL = TRUE
　　NO_SIGNAL_ERROR else" with "if COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR
　　else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

　　substitute "CARRIER_STATUS ?
　　CARRIER_ON if plca_crs = TRUE
　　CARRIER_OFF else" with "if plca_CRS = TRUE CARRIER_STATUS <= CARRIER_ON
　　else CARRIER_STATUS <= CARRIER_OFF"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general　　　　*Comment ID* **122**　　　Page 22 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn　　　　3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **148**   *SC* **148.4.6.1**   *P* **169**   *L* **1**   # 123
Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   *Editorial*
Text formatting in figure 148-6 is not clear.

SuggestedRemedy
in figure 148-6, in both TRANSMIT and FLUSH states substitute "SIGNAL_STATUS <=
SIGNAL_ERROR if COL = TRUE
NO_SIGNAL_ERROR else" with "if COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR
else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

Response   *Response Status* **C**
ACCEPT.
in figure 148-6, in both TRANSMIT and FLUSH states substitute "SIGNAL_STATUS <=
SIGNAL_ERROR if COL = TRUE
NO_SIGNAL_ERROR else" with "if COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR
else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

Cl **148**   *SC* **148.4.6.1**   *P* **169**   *L* **1**   # 124
Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   *EZ*
In figure 148-6 TXEN should be TX_EN

SuggestedRemedy
In figure 148-6 substitute "TXEN" with "TX_EN"

Response   *Response Status* **C**
ACCEPT.
In figure 148-6 substitute "TXEN" with "TX_EN"

Cl **148**   *SC* **148.4.5.1**   *P* **163**   *L* **13**   # 125
Beruto, Piergiorgio   Canova Tech

Comment Type **T**   *Comment Status* **A**   *PLCA*
In figure 148-3, the transition from RECOVER state to RECOVER state should be done
whenever some activity is sensed on the media ("plca_eri"), not only when a good
receiving is ongoing ("plca_crs"). This to avoid collision when BEACON is sent

SuggestedRemedy
In figure 148-3 substitute "plca_crs = TRUE" with "plca_eri = TRUE" in transition from
RECOVER state to RECOVER state

Response   *Response Status* **C**
ACCEPT.
In figure 148-3 substitute "plca_crs = TRUE" with "plca_eri = TRUE" in transition from
RECOVER state to RECOVER state

Cl **147**   *SC* **147.2.1**   *P* **133**   *L* **1**   # 126
Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   *EZ*
Figure 147-2 porting from draft 1.0 is incomplete

SuggestedRemedy
add label "transmitting" on arrow between PCS TRANSMIT block to PCS RECEIVE block

Response   *Response Status* **C**
ACCEPT.
Add label "transmitting" to arrow between "PCS TRANSMIT" and "PCS RECEIVE" blocks

Cl **147**   *SC* **147.3.2**   *P* **145**   *L* **3**   # 127
Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   *EZ*
"PDM" should be "PMD" (2 times)

SuggestedRemedy
Substitute "When in multidrop mode, the PDM shall be put into high-impedance/Z state"
with "When in multidrop mode, the PMD shall be put into high-impedance/Z state"

Substitute "While in point-to-point mode, the PDM shall drive" with "While in point-to-point
mode, the PMD shall drive"

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Already dealt with by #181

Cl **147**   *SC* **147.2.1**   *P* **133**   *L* **4**   # 128
Beruto, Piergiorgio   Canova Tech

Comment Type **T**   *Comment Status* **A**   *EZ*
Collision detection shall be disabled when operating in full-duplex mode

SuggestedRemedy
In figure 147-2 add an arrow named "duplex_mode" from MANAGEMENT to COLLISION
DETECTION and PCS RECEIVE blocks

Response   *Response Status* **C**
ACCEPT.
Add an arrow named "duplex_mode" from "MANAGEMENT" to " COLLISION
DETECTION" and to "PCS RECEIVE"
Note: this is a new arrow (not present in D1.0)

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **128**   Page 23 of 37
3/6/2018 4:20:49 PM

Cl **147**　　*SC* **147.2.2.3**　　　　*P* **135**　　*L* **34**　　　# 129
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **E**　　*Comment Status* **D**　　　　　*Editorial*
　　Suggest to add a page break before table 147-1 to avoid the split and improve readability

SuggestedRemedy
　　Add page break before table 147-1

Proposed Response　　　*Response Status* **Z**
　　REJECT.

　　This comment was WITHDRAWN by the commenter.

　　Discussed and rejected earlier (= current layout conforms standard clause formatting rules)

Cl **147**　　*SC* **147.2.3.1**　　　　*P* **139**　　*L* **33**　　　# 130
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **T**　　*Comment Status* **A**　　　　　*PCS*
　　In order to support full-duplex mode, the PCS RX block should be configured accordingly

SuggestedRemedy
　　Appen the following variable description to the "Variables" subclause:
　　"duplex_mode
　　indicates whether the PHY is configured for full-duplex operation (DUPLEX_FULL) or half-
　　duplex operation (DUPLEX_HALF). This variable is set after bit 8 in MDIO register 0
　　defined in table 22-7"

Response　　　　*Response Status* **C**
　　ACCEPT.
　　Add the folowing to "147.2.3.1 Variables":
　　====
　　"duplex_mode
　　indicates whether the PHY is configured for full-duplex operation (DUPLEX_FULL) or half-
　　duplex operation (DUPLEX_HALF). This variable is set after bit 8 in MDIO register 0
　　defined in table 22-7"
　　====
　　Note: "table 22-7" is a reference

Cl **147**　　*SC* **147.2.3.1**　　　　*P* **140**　　*L* **2**　　　# 131
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **T**　　*Comment Status* **A**　　　　　*State Diagram*
　　In order to support full-duplex mode, the PCS RX block should behave accordingly

SuggestedRemedy
　　In figure 147-5 replace "transmitting <= TRUE" with "(transmitting = TRUE * duplex_mode
　　= DUPLEX_HALF)"

Response　　　　*Response Status* **C**
　　ACCEPT.
　　In figure 147-5 replace "transmitting <= TRUE" (second line from top) with "(transmitting =
　　TRUE * duplex_mode = DUPLEX_HALF)"

Cl **148**　　*SC* **148.4.5.1**　　　　*P* **162**　　*L* **22**　　　# 132
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **T**　　*Comment Status* **A**　　　　　*Editorial*
　　Editor's note about figures 148-3 and 148-4 can now be removed

SuggestedRemedy
　　Remove first Editor's Note

Response　　　　*Response Status* **C**
　　ACCEPT.
　　Remove first Editor's Note

Cl **148**　　*SC* **148.4.5.2**　　　　*P* **165**　　*L* **37**　　　# 133
Beruto, Piergiorgio　　　　　　Canova Tech

Comment Type **T**　　*Comment Status* **A**　　　　　*PLCA*
　　MAX_ID can be left unconfigured on slave devices, myID shall not depend on it

SuggestedRemedy
　　Change "Values: integer value from 0 (MASTER) to MAX_ID" to "Value: integer value from
　　0 (MASTER) to 255".

Response　　　　*Response Status* **C**
　　ACCEPT. Change "Values: integer value from 0 (MASTER) to MAX_ID" to "Value: integer
　　value from 0 (MASTER) to 255".

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general　　　　*Comment ID* **133**　　Page 24 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn　　　　3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **148**   *SC* **148.4.5.2**   *P* **165**   *L* **37**   # 134
Beruto, Piergiorgio   Canova Tech

Comment Type **E**   *Comment Status* **A**   *EZ*
Missing carriage return before "Values:"

SuggestedRemedy
Add carriage return at line 37 before "Value:"

Response   *Response Status* **C**
ACCEPT.
Add carriage return at line 37 before "Value:"

Cl **146**   *SC* **146.8**   *P* **118**   *L* **38**   # 135
Fritsche, Matthias   HARTING Technology

Comment Type **T**   *Comment Status* **A**   *MDI*
SPE is a new physical layer and to define a plug and work system a new MDI is needed. RJ45 is reserved and used for the 2-pair and 4-pair Ethernet standards.

SuggestedRemedy
Alternatively for applications with lower environmental requirements a two pin shielded IP20 connector according to IEC 61076-3-125 or a two pin unshielded connector according to IEC 63171-1 shall be used in conformance to the requirements of the link segment defined in 146.7.

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Change "Alternatively for applications with lower environmental requirements a standard RJ45 connector may be
used. In this case pin 3 (BI_DA+) and pin 6 (BI_DA-) of the RJ45 connector shall be used."

to
"Alternatively for applications with lower environmental requirements a TBD connector may be used. In this case pin TBD (BI_DA+) and pin TBD (BI_DA-) of the connector shall be used."

and insert "Editor's note (to be removed prior to Working Group ballot): Commenters are encouraged to provide better specificity of "lower environmental requirements", e.g., MICE1 or IP20."

Cl **146**   *SC* **146.9.1**   *P* **120**   *L* **15**   # 136
Fritsche, Matthias   HARTING Technology

Comment Type **E**   *Comment Status* **A**   *Safety*
IEC 60950-1 is only valid up to end of 2019 and is replaced with IEC 62368-1. We should use the new safety standard

SuggestedRemedy
Replace "IEC 60950-1" with " IEC 62368-1 (former IEC 60950-1)"

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Add "or IEC 62368-1" after "IEC 60950-1"

Cl **146**   *SC* **146.11.4.5**   *P* **130**   *L* **6**   # 137
Fritsche, Matthias   HARTING Technology

Comment Type **E**   *Comment Status* **A**   *Safety*
IEC 60950-1 is only valid up to end of 2019 and is replaced with IEC 62368-1. We should use the new safety standard

SuggestedRemedy
Replace "IEC 60950-1" with " IEC 62368-1 (former IEC 60950-1)"

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Align with comment 136.
add "or IEC 62368-1" after "IEC 60950-1"

Cl **146**   *SC* **146.8**   *P* **118**   *L* **34**   # 138
Fritsche, Matthias   HARTING Technology

Comment Type **T**   *Comment Status* **A**   *MDI*
If we just specify a four pin M8/M12 or 7/8" connector, it is possible to use a bigger amount of different M8/M12 coding's from example A, B, D, and other coding's. All oth this codings are defined for special non SPE use cases only. To define a plug and work system for the market it must be defined more precisely.

SuggestedRemedy
For industrial applications also a two or four pin shielded M8/M12 connector according to IEC 61076-3-125 shall be used in conformance to the requirements of the link segment defined in 146.7.

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Insert "according to IEC 61076-3-125" to read: "For industrial applications also a four pin M8/M12 according to IEC 61076-3-125 or a four pin 7/8" connector may be used as long as it conforms to the requirements of the link segment defined in 146.7."

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **138**   Page 25 of 37
3/6/2018 4:20:49 PM

Cl **01**　　　*SC* **1.5**　　　　　　　*P* **24**　　　*L* **32**　　　# 139
Pandey, Sujan　　　　　　　　　NXP

Comment Type **ER**　　*Comment Status* **A**　　　　　　*EZ*
PLCS

SuggestedRemedy
PLCA

Response　　　　　*Response Status* **C**
ACCEPT. Replace "PLCS" on line 32 with "PLCA" (Same resolution proposed for comments #139, #3, and #188)

Cl **147**　　　*SC* **147.3.3**　　　　*P* **145**　　*L* **39**　　　# 140
Pandey, Sujan　　　　　　　　　NXP

Comment Type **TR**　　*Comment Status* **A**　　　　　　*EZ*
The symbol sequence J/J/J/K which replaces the first 16 bit of packet preamble

SuggestedRemedy
The symbol sequence J/J/J/K which replaces the first 20 bit of packet preamble

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
Change "J/J/J/K which replaces the first 16 bit of" to "J/J/J/K which replaces the first 20 bits of"

Cl **148**　　　*SC* **148.4.2**　　　　*P* **157**　　*L* **33**　　　# 141
Pandey, Sujan　　　　　　　　　NXP

Comment Type **TR**　　*Comment Status* **R**　　　　　　*PLCA*
Figure 148-2 is misleading. Figure tells that gRS will not be a part of PHY and PLCA state machines are defined outside of the PHY. Is this according to the objective of 802.3cg?

SuggestedRemedy
Figure should be drawn such that PLCA RS layer should be inside the PHY

Response　　　　　*Response Status* **C**
REJECT.
The Reconciliation Sublayer (RS) is part of a PHY project, translating the MAC/PLS service interface to signals for the PHY, and the figure is in line with other Reconciliation sublayers in 802.3

Cl **148**　　　*SC* **148.4.2**　　　　*P* **157**　　*L* **12**　　　# 142
Pandey, Sujan　　　　　　　　　NXP

Comment Type **TR**　　*Comment Status* **A**　　　　　　*PLCA*
What is the size of PLCA delay unit?

SuggestedRemedy
Specify the size

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
Delay is variable, and it's described in PLCA DATA State Machine. Solved by #144

Cl **148**　　　*SC* **0**　　　　　　　*P*　　　*L*　　　# 143
Pandey, Sujan　　　　　　　　　NXP

Comment Type **T**　　*Comment Status* **A**　　　　　　*Editorial*
muyID should be renamed

SuggestedRemedy
local_ID

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
I would propose naming it nodeID (to be discussed with the group)

EDITOR: Search and replace all occurrences of "myID" variable with "local_nodeID"

Cl **148**　　　*SC* **148.4.2**　　　　*P* **157**　　*L* **12**　　　# 144
Pandey, Sujan　　　　　　　　　NXP

Comment Type **T**　　*Comment Status* **A**　　　　　　*Editorial*
delay line is not a good name

SuggestedRemedy
FIFO

Response　　　　　*Response Status* **C**
ACCEPT IN PRINCIPLE.
FIFO suggests a specific implementation, I think we should be more generic.

EDITOR: replace "PLCA delay line" with "variable delay line"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **144**　　　　Page 26 of 37
3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.6.1**   *P* **168**   *L* **1**   # 145

Pandey, Sujan   NXP

Comment Type **T**   *Comment Status* **A**   *PLCA*

Figure 148-5: The variable a and b should be more descriptive

SuggestedRemedy

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.

NOTE: malformed comment, no suggested remedy is present. But there's a problem with the figure.

EDITOR: In figure 148-5 add a re-circulating ARC on FLUSH state with condition "MCD * a != b" with "!=" being the "not equal" sign.

At page 170, line 38: replace "a, b" description with the following TWO descriptions (one for 'a' and one for 'b'):
"a current delay counter"
"b flush counter"

Cl **22**   *SC* **22.2.2.4**   *P*   *L*   # 146

Pandey, Sujan   NXP

Comment Type **T**   *Comment Status* **R**   *PLCA*

in Table 22-1 & 22-2. Why do we need these new codes over this interface if the MAC in an SoC or Bridge is not to be modified per this project? See the Objectives.

SuggestedRemedy

Please clarify with NOTES in the draft.

Response   *Response Status* **C**

REJECT. These new codes do not change either the Ethernet frame format at the MAC client service interface, the frame size of the current IEEE 802.3 standard, or the speed from 10 Mb/s at the interface, per the objectives. They are used as part of the new Reconciliation Sublayer, as defined in Clause 148, and the text in the second paragraph of 22.2.4 provides a description of the purpose and points to clause 148. Clause 22 is the Reconciliation Sublayer (RS), not the MAC, which is a valid target for a PHY project and within the objectives. The purpose of the signals is clear - to communicate the RS PLCA BEACON, and PLCA COMMIT. IEEE 802.3 style, evidenced by the inclusion of LPI by EEE, does not support the addition of a note to the table.

Cl **147**   *SC* **147.4.1**   *P* **146**   *L* **26**   # 147

Zerna, Conrad   Fraunhofer

Comment Type **T**   *Comment Status* **A**   *PMA*

Replace "generated by PRBS7 with the generating polynomial of x^7+x^6+1." with

SuggestedRemedy

"generated by PRBS7 with the generating polynomial of x^7+x^6+1 encoded using Differential Manchester Encoding (DME) as in 147.3.2."

Response   *Response Status* **C**

ACCEPT.
Add "encoded using Differential Manchester Encoding (DME) as in 147.3.2" between "polynomial of x^7+x^6+1" and the closing period (".")
Note: "147.3.2" is a reference

Cl **147**   *SC* **147.4.1.3.1**   *P* **147**   *L* **28**   # 148

Zerna, Conrad   Fraunhofer

Comment Type **T**   *Comment Status* **D**   *PSD*

Comment Group "TX amplitude, PSD and Emissions"
Replace
"
        -61   0.3MHz <= f < 15MHz
UppePSD(f) = { -41-1.4*f   15MHz <= f < 25MHz   } [dBm/Hz]
        -75   25MHz <= f
"
with

SuggestedRemedy

"
        -72   0.3MHz <= f < 15MHz
UppePSD(f) = { -52-1.4*f   15MHz <= f < 25MHz   } [dBm/Hz]
        -86   25MHz <= f
"

--> also presentation

Proposed Response   *Response Status* **Z**

REJECT.
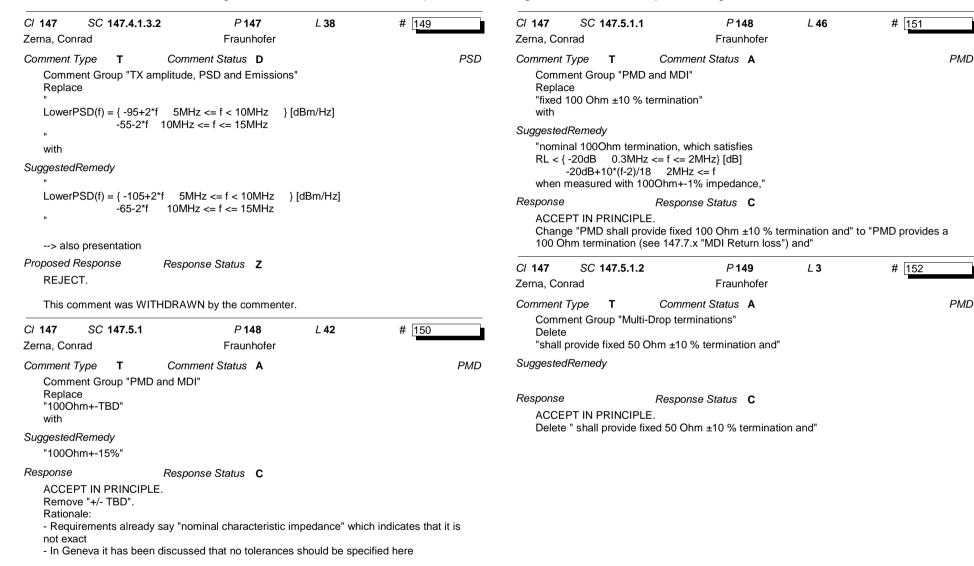
This comment was WITHDRAWN by the commenter.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **148**   Page 27 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **147**　　*SC* **147.4.1.3.2**　　　*P* **147**　　*L* **38**　　# 149
Zerna, Conrad　　　　　　　　　　Fraunhofer

Comment Type　**T**　　*Comment Status*　**D**　　　　　　*PSD*
Comment Group "TX amplitude, PSD and Emissions"
Replace
"

LowerPSD(f) = { -95+2*f　　5MHz <= f < 10MHz　　} [dBm/Hz]
　　　　　　　　-55-2*f　　10MHz <= f <= 15MHz

"
with

SuggestedRemedy
"

LowerPSD(f) = { -105+2*f　　5MHz <= f < 10MHz　　} [dBm/Hz]
　　　　　　　　-65-2*f　　10MHz <= f <= 15MHz

"

--> also presentation

Proposed Response　　　*Response Status*　**Z**
REJECT.

This comment was WITHDRAWN by the commenter.

Cl **147**　　*SC* **147.5.1**　　　*P* **148**　　*L* **42**　　# 150
Zerna, Conrad　　　　　　　　　　Fraunhofer

Comment Type　**T**　　*Comment Status*　**A**　　　　　　*PMD*
Comment Group "PMD and MDI"
Replace
"100Ohm+-TBD"
with

SuggestedRemedy
"100Ohm+-15%"

Response　　　　　　*Response Status*　**C**
ACCEPT IN PRINCIPLE.
Remove "+/- TBD".
Rationale:
- Requirements already say "nominal characteristic impedance" which indicates that it is
not exact
- In Geneva it has been discussed that no tolerances should be specified here

Cl **147**　　*SC* **147.5.1.1**　　　*P* **148**　　*L* **46**　　# 151
Zerna, Conrad　　　　　　　　　　Fraunhofer

Comment Type　**T**　　*Comment Status*　**A**　　　　　　*PMD*
Comment Group "PMD and MDI"
Replace
"fixed 100 Ohm ±10 % termination"
with

SuggestedRemedy
"nominal 100Ohm termination, which satisfies
RL < { -20dB　　0.3MHz <= f <= 2MHz} [dB]
　　　-20dB+10*(f-2)/18　　2MHz <= f
when measured with 100Ohm+-1% impedance,"

Response　　　　　　*Response Status*　**C**
ACCEPT IN PRINCIPLE.
Change "PMD shall provide fixed 100 Ohm ±10 % termination and" to "PMD provides a
100 Ohm termination (see 147.7.x "MDI Return loss") and"

Cl **147**　　*SC* **147.5.1.2**　　　*P* **149**　　*L* **3**　　# 152
Zerna, Conrad　　　　　　　　　　Fraunhofer

Comment Type　**T**　　*Comment Status*　**A**　　　　　　*PMD*
Comment Group "Multi-Drop terminations"
Delete
"shall provide fixed 50 Ohm ±10 % termination and"

SuggestedRemedy

Response　　　　　　*Response Status*　**C**
ACCEPT IN PRINCIPLE.
Delete " shall provide fixed 50 Ohm ±10 % termination and"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **152**　　　Page 28 of 37
3/6/2018 4:20:49 PM

Cl **147**   *SC* **147.5.1.2**   *P* **149**   *L* **12**   # 153

Zerna, Conrad   Fraunhofer

Comment Type **T**   *Comment Status* **A**   *PMD*

Comment Group "Multi-Drop terminations"
Replace
"by two 100 Ohm (nominal) resistances at the edges"
with

SuggestedRemedy

"by two 100 Ohm (nominal) impedances satisfying
RL < { -23dB   0.3MHz <= f <= 2MHz} [dB]
       -23dB+10*(f-2)/18   2MHz <= f
when measured with 100Ohm+-1% impedance, at the edges "

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
- Add a new sub-clause "147.7 MDI"
- Add a new sub-cluase under 147.7 MDI", called "147.7.x (1 for now) MDI Return loss"
- Add a new for formula copied from 146.8.3 with commenter's content
Notes:
- Also change "resitance" to "impedance"
- See also comment #77

Cl **147**   *SC* **147.5.1.2**   *P* **149**   *L* **16**   # 154

Zerna, Conrad   Fraunhofer

Comment Type **T**   *Comment Status* **A**   *PMD*

Comment Group "Multi-Drop terminations"
Fix figure to reflect textual changes of comment group

SuggestedRemedy

see jpg file "draft1p1_correction_fig147-11_multidropTerm.jpg"

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
- Make changes as per zimmerman_3cg_01_0318.pdf:
  - page 5/15: "make 147.4.1.1 to 147.4.1.4 subclauses 147.4.3.1 through 147.4.3.4"
  - page 5/15: 2 items under "Specify high impedance mode and test mode:"
  - page 6/15: 3 items
  - pages 7-8/15: 2 items (fix typo "146.6" to "147.6" along the way)
  - moreover: change the symbol used for the 3 termination points and add the label/arrow
for "stub termination" with arrow style matching that of the label "edge termination", as per
the attached file (147-11.png)
  - pages 9-14/15: as described (renumbering to be done at the end)
- See also comment #77

Cl **147**   *SC* **147.6.3**   *P* **150**   *L* **27**   # 155

Zerna, Conrad   Fraunhofer

Comment Type **T**   *Comment Status* **D**   *Link Segment*

Comment Group "TX amplitude, PSD and Emissions"
Replace
"
ModeConversionLoss(f) = { 43   0.3MHz <= f < 20MHz } [dBm/Hz]
               43-20*log10(f/20)   20MHz <= f <= 200MHz
"
with

SuggestedRemedy

"
ModeConversionLoss(f) = { 46   0.3MHz <= f < 20MHz } [dBm/Hz]
               46-20*log10(f/20)   20MHz <= f <= 200MHz
"

--> also presentation

Proposed Response   *Response Status* **Z**

REJECT.

This comment was WITHDRAWN by the commenter.

Cl **146**   *SC* **146.7.1.2**   *P* **114**   *L* **38**   # 156

DiMinico, Christopher   MC Communications

Comment Type **T**   *Comment Status* **A**   *EZ*

Comment # 238 D1.0 to correct Figure 146-22 was not implemented by editor.

SuggestedRemedy

New figure needs to be generated using Equation (146-10) values.

Response   *Response Status* **C**

ACCEPT.

Cl **146**   *SC* **146.7.1.3**   *P* **115**   *L* **36**   # 157

DiMinico, Christopher   MC Communications

Comment Type **T**   *Comment Status* **A**   *Link Segment*

Remove TBD: 146.7.1.3 Maximum link delay (TBD)

SuggestedRemedy

Remove TBD: 146.7.1.3 Maximum link delay (TBD)

Response   *Response Status* **C**

ACCEPT.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general   *Comment ID* **157**   Page 29 of 37
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn   3/6/2018 4:20:49 PM
SORT ORDER: Comment ID

Cl **148** *SC* **148.1** *P* **155** *L* **11** # 158
Zimmerman, George CME Consulting et al

Comment Type **T** *Comment Status* **A** *Editorial*

"Currently, the 10BASE-T1S PHY in Clause 147 specifies support for PLCA Reconciliation sublayer." I think what this means is better stated as "The PLCA sublayer is specified for operation with the PHY defined in Clause 147 (10BASE-T1S)."

SuggestedRemedy

Replace "Currently, the 10BASE-T1S PHY in Clause 147 specifies support for PLCA Reconciliation sublayer." with "The PLCA sublayer is specified for operation with the PHY defined in Clause 147 (10BASE-T1S)."

Response *Response Status* **C**

ACCEPT.
Replace "Currently, the 10BASE-T1S PHY in Clause 147 specifies support for PLCA Reconciliation sublayer." with "The PLCA sublayer is specified for operation with the PHY defined in Clause 147 (10BASE-T1S)."

Cl **148** *SC* **148.2** *P* **155** *L* **19** # 159
Zimmerman, George CME Consulting et al

Comment Type **E** *Comment Status* **A** *Editorial*

The Overview section should provide a description of the function that is defined, not discuss the goal of the clause itself. Descriptive text is needed.

SuggestedRemedy

Delte existing 148.2 text. Replace with "Editor's Note (to be removed prior to Working Group ballot): High level description of the operation and specification of PLCA is needed here (description only, no requirements)"

Response *Response Status* **C**

ACCEPT.
Comment: that was copied from other clauses but I agree.

EDITOR: Delete existing 148.2 text. Replace with "Editor's Note (to be removed prior to Working Group ballot): High level description of the operation and specification of PLCA is needed here (description only, no requirements)"

Cl **148** *SC* **148.4.2** *P* **157** *L* **1** # 160
Zimmerman, George CME Consulting et al

Comment Type **E** *Comment Status* **A** *PLCA*

"(plca_en = OFF in register TBD)" - the important thing is the variable, the implementaton in a register is optional and, if implemented, will be documented elsewhere. This same "in register TBD" occurs in several places (148.4.2, 148.4.3.1, 148.4.3.3, 148.4.3.4, 148.4.5.1)

SuggestedRemedy

delete "in register TBD" in 148.4.2, 148.4.3.1, 148.4.3.3, 148.4.3.4, 148.4.5.1.

Response *Response Status* **C**

ACCEPT.
delete "in register TBD" in 148.4.2, 148.4.3.1, 148.4.3.3, 148.4.3.4, 148.4.5.1.

Cl **148** *SC* **148.4.2** *P* **157** *L* # 161
Zimmerman, George CME Consulting et al

Comment Type **T** *Comment Status* **A** *Editorial*

"The following provides an overview of RS PLCA operation. The actual specification of RS PLCA operation can be found in the respective RS clauses.
When TSSI support is also specified in the actual RS, the SFD detection of transmitted frames shall be detected after the PLCA variable delay line, as shown in Figure 148-2. This ensures the network latency measurement is not affected by the synchronization latency added by PLCA. No special attention is required for SFD detection of received frames." - several problems. first, what follows is not an overview of the RS PLCA operation. that shoudl be in the overview section and is missing. Second, the statement about TSSI is a stated as a requirement which should be called out separately - or should it be a recommentation? unclear.

SuggestedRemedy

Delete "The following provides... Respective RS clauses." Add new subclause "148.4.2.1 Operation with TSSI" and put sentences from "When TSSI support... detection of received frames" in it.

Response *Response Status* **C**

ACCEPT.
Delete "The following provides... Respective RS clauses." Add new subclause "148.4.2.1 Operation with TSSI" and put sentences from "When TSSI support... detection of received frames" in it.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **161** Page 30 of 37
3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.1**   *P* **155**   *L* **38**   # 162
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*
"specified elsewhere in this standard" - please say what clauses you are extending

SuggestedRemedy
Change "specified elsewhere in this standard" with "specified in Clauses ...." (whatever those clauses may be). If there are specific clauses clause 148 may or may not be used with, list that information too.

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.

Change "specified elsewhere in this standard" with "specified in Clause 22"

Cl **148**   *SC* **148.4.1**   *P* **155**   *L* **39**   # 163
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *EZ*
"this subclause" - you mean Clause 148, not just 148.4.1, no?

SuggestedRemedy
Replace "this subclause" with "Clause 148".

Response   *Response Status* **C**
ACCEPT.
Replace "this subclause" with "Clause 148".

Cl **148**   *SC* **148.4.3.1.2**   *P* **158**   *L* **11**   # 164
Zimmerman, George   CME Consulting et al

Comment Type **E**   *Comment Status* **A**   *EZ*
"The values ONE and ZERO are conveyed to the PLCA variable plca_txd<3>,..." the values are conveyed BY the PLCA variables, not to the variables...

SuggestedRemedy
change "to the PLCA variable " to "by the PLCA variables"

Response   *Response Status* **C**
ACCEPT.
change "to the PLCA variable " to "by the PLCA variables"

Cl **148**   *SC* **148**   *P* **164**   *L* **47**   # 165
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *PLCA*
Figure 148-4, arc from NEXT_TS to WAIT_TO has no exit condition

SuggestedRemedy

Response   *Response Status* **C**
ACCEPT.
Solved by #119

EDITOR: add "else" as exit condition

Cl **148**   *SC* **148.4.4.2.1**   *P* **160**   *L* **25**   # 166
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*
"master PHY" - the terms MASTER and SLAVE are used repeatedly and even in this amendment to refer to loop timing. A different relationship is meant here for the optional PLCA RS. Using master and slave is not advised. In many places, like this one, the term is not needed. tag: PLCA_MASTER

SuggestedRemedy
Delete "from the master" at P 160 L25. In all other cases, term master can be omitted - see other comments tagged PLCA_MASTER

Response   *Response Status* **C**
ACCEPT.
Delete "from the master" at P 160 L25.

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **166**   Page 31 of 37
3/6/2018 4:20:49 PM

Cl **148**　　*SC* **148.4.5.1**　　　*P* **161**　　*L* **26**　　　# `167`
Zimmerman, George　　　　　CME Consulting et al

Comment Type　**T**　　*Comment Status*　**A**　　　　*Editorial*
　　eliminate "master" "slave" - tag: PLCA_MASTER

SuggestedRemedy
　　Change "When PLCA functions are enabled, the master PHY (the one having myID
　　variable set to 0) immediately" to "When PLCA functions are enabled, the PHY with myID
　　set to 0 immediately"

Response　　　　　*Response Status*　**C**
　　ACCEPT IN PRINCIPLE.
　　myID needs to be renamed as per comment #1

　　EDITOR: Change "When PLCA functions are enabled, the master PHY (the one having
　　myID variable set to 0) immediately" to "When PLCA functions are enabled, the PHY with
　　local_nodeID set to 0 immediately"

Cl **148**　　*SC* **148.4.5.1**　　　*P* **161**　　*L* **28**　　　# `168`
Zimmerman, George　　　　　CME Consulting et al

Comment Type　**T**　　*Comment Status*　**A**　　　　*Editorial*
　　"Slave PHYs wait in RESYNC state until a BEACON is sent by the master PHY." - actually
　　they wait until a BEACON is received. Tag: PLCA_MASTER

SuggestedRemedy
　　change "is sent by the master PHY" to "is received"

Response　　　　　*Response Status*　**C**
　　ACCEPT.
　　change "is sent by the master PHY" to "is received"

Cl **148**　　*SC* **148.4.5.1**　　　*P* **161**　　*L* **30**　　　# `169`
Zimmerman, George　　　　　CME Consulting et al

Comment Type　**T**　　*Comment Status*　**A**　　　　*Editorial*
　　"Both the slave PHYs and the master PHY are required to detect the end of the BEACON
　　condition before resetting the transmit opportunity timer" - actually, All PHYs are
　　required...　Use of "are required" is discouraged too.　Tag: PLCA_MASTER

SuggestedRemedy
　　Change "Both the slave PHYs and the master PHY are required to detect the end..." to "All
　　PHYs are detect the end..."

Response　　　　　*Response Status*　**C**
　　ACCEPT.
　　Fixed typo

　　Change "Both the slave PHYs and the master PHY are required to detect the end" to "All
　　PHYs detect the end"

Cl **148**　　*SC* **148.4.5.1**　　　*P* **161**　　*L* **35**　　　# `170`
Zimmerman, George　　　　　CME Consulting et al

Comment Type　**T**　　*Comment Status*　**A**　　　　*Editorial*
　　"while TPD is the worst-case propagation delay time between the master and all slave
　　PHYs." actually, TPD is the worst-case propagation delay time from end-to-end of the
　　mixing segment. Tag: PLCA_MASTER

SuggestedRemedy
　　Change "between the master and all slave PHYs" to "from end-to-end on the mixing
　　segment."

Response　　　　　*Response Status*　**C**
　　ACCEPT.

　　Change "between the master and all slave PHYs" to "from end-to-end on the mixing
　　segment."

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected　　RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **170**

Page 32 of 37

3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.5.1**   *P* **162**   *L* **6**   # 171
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*

"The recovery procedure forces a slave PHY to wait for the next BEACON and a master PHY to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON." eliminate master/slave Tag: PLCA_MASTER

SuggestedRemedy

Change "The recovery procedure forces a slave PHY to wait for the next BEACON and a master PHY to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON." to "The recovery procedure forces the PHY with myID=0 to wait for all other PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON, and all other PHYs to wait for the next BEACON to be received."

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
myID renamed to nodeID as per comment #1

Change "The recovery procedure forces a slave PHY to wait for the next BEACON and a master PHY to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON." to "The recovery procedure forces the PHY with nodeID=0 to wait for all other PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON, and all other PHYs to wait for the next BEACON to be received."

Cl **148**   *SC* **148.4.5.2**   *P* **165**   *L* **36**   # 172
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*

"The special value '0' is assigned to the master node, indicating the PHY shall generate BEACON signals. Values: integer value from 0 (master) to MAX_ID." - eliminate master/slave, and eliminate duplicate "shall" which is really contained in the state diagram. Tag: PLCA_MASTER

SuggestedRemedy

Change "The special value '0' is assigned to the master node, indicating the PHY shall generate BEACON signals. Values: integer value from 0 (master) to MAX_ID." to "The special value '0' is assigned to the PHY which generates BEACON signals. Values: integer value from 0 to MAX_ID."

Response   *Response Status* **C**

ACCEPT.

Change "The special value '0' is assigned to the master node, indicating the PHY shall generate BEACON signals. Values: integer value from 0 (master) to MAX_ID." to "The special value '0' is assigned to the PHY which generates BEACON signals. Values: integer value from 0 to MAX_ID."

Cl **148**   *SC* **148.4.5.2**   *P* **165**   *L* **41**   # 173
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*

"This parameter is only meaningful for the master PHY (myID = 0). For slave PHYs, MAX_ID is ignored." - eliminate master/slave Tag: PLCA_MASTER

SuggestedRemedy

Change "This parameter is only meaningful for the master PHY (myID = 0). For slave PHYs, MAX_ID is ignored." to "This parameter is only meaningful for the PHY with myID = 0, otherwise it is ignored."

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
myID should be renamed as per comment #1

Change "This parameter is only meaningful for the master PHY (myID = 0). For slave PHYs, MAX_ID is ignored." to "This parameter is only meaningful for the PHY with nodeID = 0, otherwise it is ignored."

Cl **148**   *SC* **148.4.5.4**   *P* **166**   *L* **11**   # 174
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*

"Represents the time for which the master PHY signals a BEACON condition." - isn't this timer the duration of the BEACON? - also eliminate master/slave Tag: PLCA_MASTER

SuggestedRemedy

Change "Represents the time for which the master PHY signals a BEACON condition." to "Times the duration of the BEACON signal."

Response   *Response Status* **C**

ACCEPT.
Change "Represents the time for which the master PHY signals a BEACON condition." to "Times the duration of the BEACON signal."

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **174**   Page 33 of 37
3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.5.4**   *P* **166**   *L* **30**   # **175**
Zimmerman, George   CME Consulting et al

Comment Type **T**   *Comment Status* **A**   *Editorial*

"During a recovery operation the master PHY needs to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON request." - a BEACON is not a request, it is a BEACON, no? - also eliminate master/slave Tag: PLCA_MASTER

SuggestedRemedy

Change "During a recovery operation the master PHY needs to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON request." to "During recovery, RECV_BEACON_TIMER times the period that all PHYs need to be silent before a new BEACON may be sent."

Response   *Response Status* **C**

ACCEPT.
Change "During a recovery operation the master PHY needs to wait for all slave PHYs to be silent for at least RECV_BEACON_TIMER before sending a new BEACON request." to "During recovery, RECV_BEACON_TIMER times the period that all PHYs need to be silent

---

Cl **148**   *SC* **148.4.6.1**   *P* **168**   *L* **9**   # **176**
Zimmerman, George   CME Consulting et al

Comment Type **E**   *Comment Status* **A**   *Editorial*

Nomenclature is backwards in conditionals in state diagrams of clause 148, for example "SIGNAL_STATUS <= SIGNAL_ERROR IF COL = TRUE" should be " If COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR Else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

SuggestedRemedy

Change format to if - then - else, and put complete assignments as "then" or "else" (see example in comment.) Do this for "NORMAL", "RECEIVE" and "TRANSMIT" states in Figures 148-5 and 148-6

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
See resolutions to comments 122 and 123

in figure 148-5 substitute "SIGNAL_STATUS ?
SIGNAL_ERROR if COL = TRUE
NO_SIGNAL_ERROR else" with "if COL = TRUE SIGNAL_STATUS <= SIGNAL_ERROR
 else SIGNAL_STATUS <= NO_SIGNAL_ERROR"

substitute "CARRIER_STATUS ?
CARRIER_ON if plca_crs = TRUE
CARRIER_OFF else" with "if plca_CRS = TRUE CARRIER_STATUS <= CARRIER_ON
 else CARRIER_STATUS <= CARRIER_OFF"

Cl **45**   *SC* **45.2.1.174e.5**   *P* **39**   *L* **4**   # **177**
iyer, venkat   microchip

Comment Type **T**   *Comment Status* **A**   *PMA*

how is receive polarity defined for multi-drop and DME

SuggestedRemedy

not defined

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE. Change registers for resevered bits in Table 45-142e from "1.2300.7:3" to "1.2300.7:3", delete the entire row for Received polarity bit 1.2300.7:2 in Table 45-142e, and delete all of clause 45.2.1.174e.5 (Receive polarity (1.2300.2)) from lines 4 through 8. Renumbering following clauses accordingly.

Cl **147**   *SC* **147.1.2**   *P* **131**   *L* **40**   # **178**
iyer, venkat   microchip

Comment Type **T**   *Comment Status* **A**   *Editorial*

use of 'can' doesn't conform to IEEE style manual creating ambiguity and possible conflict with objectives

SuggestedRemedy

The 10BASE-T1S PHY shall opererate using half-duplex point to point...Optionally, the PHY can operate using half-duplex multi-drop...Optionally, the PHY can operate using full-duplex....

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
- Change "The 10BASE-T1S PHY can operate" to "The 10BASE-T1S PHY may operate"
- Change "Additionally, the 10BASE-T1S PHY can operate" to "Additionally, the 10BASE-T1S PHY may operate"

Cl **147**   *SC* **147.2.2.1**   *P* **133**   *L* **53**   # **179**
iyer, venkat   microchip

Comment Type **T**   *Comment Status* **A**   *State Diagram*

in clause 147 'symbol' seems to be the more common understanding than symbol group (sorry for back tracking change I had suggested)

SuggestedRemedy

replace symbol group with symbol

Response   *Response Status* **C**

ACCEPT IN PRINCIPLE.
Already dealt with by #106

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **179**   Page 34 of 37
3/6/2018 4:20:49 PM

Cl **147** *SC* **147.3.3** *P* **145** *L* **32** # 180
iyer, venkat microchip

Comment Type **T** *Comment Status* **A** Editorial

SuggestedRemedy
replace symbol groups with symbols

Response *Response Status* **C**
ACCEPT.
Change "5B symbol groups" to "5B symbols"

Cl **147** *SC* **147.3.2** *P* **145** *L* **3** # 181
iyer, venkat microchip

Comment Type **E** *Comment Status* **A** EZ
typo

SuggestedRemedy
PDM shouldbe PMD

Response *Response Status* **C**
ACCEPT IN PRINCIPLE.
- Change "the PDM shall be" to "the PMD shall be"
- Change "the PDM shall drive" to "the PMD shall drive"

Cl **147** *SC* **147.3.2** *P* **145** *L* **4** # 182
iyer, venkat microchip

Comment Type **E** *Comment Status* **A** EZ
typo

SuggestedRemedy
PDM shouldbe PMD

Response *Response Status* **C**
ACCEPT IN PRINCIPLE.
Already dealt with by #181

Cl **147** *SC* **147.4.1.1** *P* **146** *L* **45** # 183
iyer, venkat microchip

Comment Type **T** *Comment Status* **A** PMA
if auto negotiation is optional, how can it be the default setting?

SuggestedRemedy
delete "default setting is to use Auto Negotiation"

Response *Response Status* **C**
ACCEPT.
Remove the whole sentence " Default setting is to use Auto Negotiation."

Cl **148** *SC* **148.1** *P* **155** *L* **7** # 184
iyer, venkat microchip

Comment Type **T** *Comment Status* **A** PLCA
maximum latency is bad

SuggestedRemedy
replace maximum with reduced

Response *Response Status* **C**
ACCEPT IN PRINCIPLE.
This is descriptive text. I propose to just remove maximum.

EDITOR: replace "maximum throughput and maximum latency" with "throughput and latency"

Cl **148** *SC* **148.4.5.2** *P* **165** *L* **35** # 185
iyer, venkat microchip

Comment Type **T** *Comment Status* **A** AutoNeg
"may" implies actions are part of specification. But PLCA variables negotiation is not detailed in spec

SuggestedRemedy
delete " may also be set..98"

Response *Response Status* **C**
ACCEPT IN PRINCIPLE.
Change "Generated by the management interface (register TBD). May also be set by the Auto-Negotiation protocol as described in Clause 98."
To: "Generated by management interface (or equivalent functionality if MDIO is not implemented)".

Insert "Editor's Note (to be removed prior to Working Group Ballot): Specify whether and how PLCA parameters may be negotiated (e.g., Clause 98)"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **185** Page 35 of 37
3/6/2018 4:20:49 PM

Cl **148**   *SC* **148.4.5.2**   *P* **165**   *L* **43**   # 186
iyer, venkat   microchip

Comment Type **T**   *Comment Status* **A**   *AutoNeg*
"may" indicates actions are part of specification. But PLCA variables negotiation is not detailed in spec

SuggestedRemedy
delete "MAX_ID may also be set..98"

Response   *Response Status* **C**
ACCEPT IN PRINCIPLE.
Solved by #185

EDITOR: delete "MAX_ID may also be set..98"

Insert "Editor's Note (to be removed prior to Working Group Ballot): Specify whether and how PLCA parameters may be negotiated (e.g., Clause 98)"

Cl **146**   *SC* **146.A.1**   *P* **176**   *L* **13**   # 187
iyer, venkat   microchip

Comment Type **T**   *Comment Status* **R**   *Safety*
figures in annex show PHY with separate TX and RX pins

SuggestedRemedy

Response   *Response Status* **C**
REJECT.
These figures are shown as a 'possible implementation' - separate inputs are shown for clarity and maximum flexibility.

Cl **01**   *SC* **1.5**   *P* **24**   *L* **32**   # 188
Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*
Incorrect acronym "PLCS" instead of "PLCA"

SuggestedRemedy
Change "PLCS" to "PLCA"

Response   *Response Status* **C**
ACCEPT. Replace "PLCS" on line 32 with "PLCA" (Same resolution proposed for comments #139, #3, and #188)

Cl **45**   *SC* **45.2.1.174a.1**   *P* **33**   *L* **4**   # 189
Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*
"This operation may interrupt data communication." line is not consistent with other reset bit descriptions which include "NOTE -".

SuggestedRemedy
Change to "NOTE - This operation may interrupt data communication."

Response   *Response Status* **C**
ACCEPT. Replace "This operation may interrupt data communication." with "NOTE - This operation may interrupt data communication." and apply Paragraph tag Note

Cl **45**   *SC* **45.2.1.174d.1**   *P* **37**   *L* **7**   # 190
Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*
"This operation may interrupt data communication." line is not consistent with other reset bit descriptions which include "NOTE -".

SuggestedRemedy
Change to "NOTE - This operation may interrupt data communication."

Response   *Response Status* **C**
ACCEPT. Replace "This operation may interrupt data communication." with "NOTE - This operation may interrupt data communication." and apply Paragraph tag Note

Cl **45**   *SC* **45.2.1.174d.3**   *P* **37**   *L* **22**   # 191
Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*
Incorrect reference to 10BASE-T1L PMA control register/bit 1.2294.11 rather than 10BASE-T1S PMA control.

SuggestedRemedy
Change "1.2294.11" to "1.2299.11"

Response   *Response Status* **C**
ACCEPT. Change "1.2294.11" to "1.2299.11"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **191**   Page 36 of 37
3/6/2018 4:20:49 PM

Cl **45**   *SC* **45.2.1.174d.3**   *P* **37**   *L* **27**   # 192

Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*

Incorrect reference to 10BASE-T1L PMA control register/bit 1.2294.11 rather than 10BASE-T1S PMA control.

SuggestedRemedy

Change "1.2294.11" to "1.2299.11"

Response   *Response Status* **C**

ACCEPT. Change "1.2294.11" to "1.2299.11"

Cl **45**   *SC* **45.2.1.174h.1**   *P* **41**   *L* **23**   # 193

Baggett, Tim   Microchip

Comment Type **E**   *Comment Status* **A**   *EZ*

Incorrect reference section 147.5.2 should be 147.4.1

SuggestedRemedy

Change "147.5.2" to "147.4.1"

Response   *Response Status* **C**

ACCEPT. Change "147.5.2" to "147.4.1"

TYPE: TR/technical required ER/editorial required GR/general required T/technical E/editorial G/general
COMMENT STATUS: D/dispatched A/accepted R/rejected   RESPONSE STATUS: O/open W/written C/closed Z/withdrawn
SORT ORDER: Comment ID

Comment ID **193**   Page 37 of 37
3/6/2018 4:20:49 PM